

General Information

Date & Time: 14, Nov, 2025 15:57

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	68,448
Registration No.	NEL2378-1	Chassis No.	PA1B18F30M4143197
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



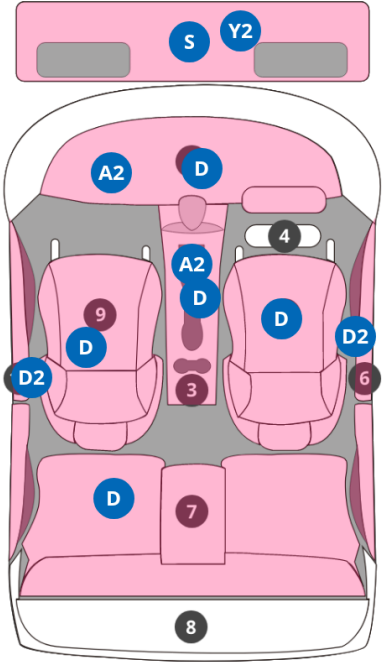
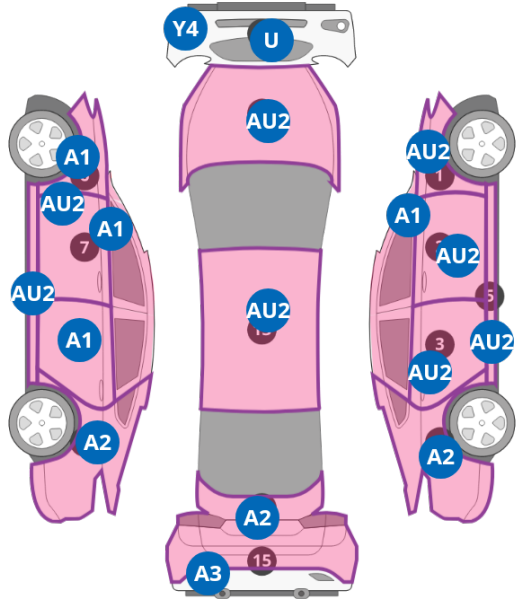
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	458.3	795	260	320
2	Boot Lid	266.3	477	140	182
3	Roof	243.6	166	181	528/100
4	Left Front Fender	397.0	331	657	203
5	Left Front Door	177.3	188	154	190
6	Center Panel Left				
7	Left Rear Door	309.3	284	289	355
8	Left Back Panel	260.0	274	293	213
9	Right Front Fender	490.3	271	142	1,058
10	Right Front Door	105.3	112	100	104
11	Center Panel Right				
12	Right Rear Door	102.6	100	102	106
13	Right Back Panel	110.6	108	113	111

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Roof - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small
Frame Evaluation : D	Functional Evaluation : A
Remarks Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Condition of Welding ? - Yes / Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Center Pillar - Condition of Welding ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

With LTO plate and Spare tire, No Tools and Jack and Warranty booklet, scratch and crack tail light and headlight, worn tires and Spare tire, No trunk cover, No reverse camera, No spare key, Abnormal vibration on engine, foul smell.