

General Information

Date & Time: 13, Dec, 2025 09:16

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	33,689
Registration No.	GAS6713	Chassis No.	MHKA4DE5FNJ017677
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



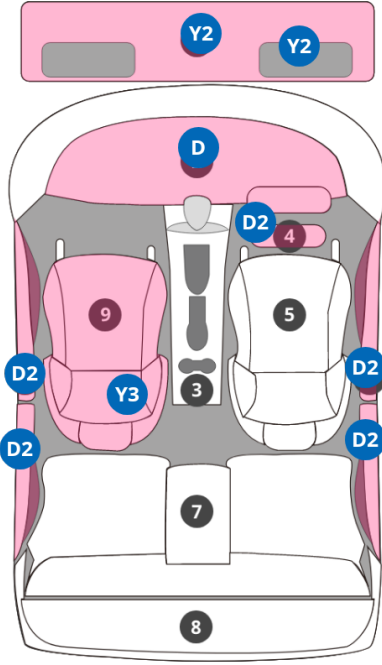
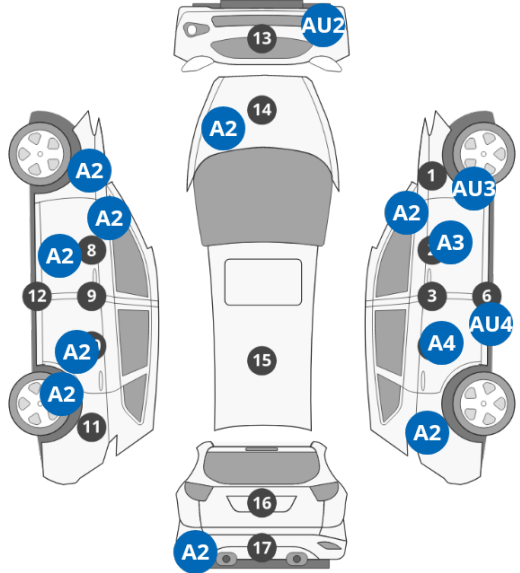
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	96	107	110
2	Boot Lid	103.3	107	104	99
3	Roof	85.1	75	87	86/94
4	Left Front Fender	97.7	98	105	91
5	Left Front Door	107.0	105	111	105
6	Center Panel Left				
7	Left Rear Door	109.3	111	108	109
8	Left Back Panel	102.7	105	112	91
9	Right Front Fender	107.6	103	112	108
10	Right Front Door	110.0	110	115	105
11	Center Panel Right				
12	Right Rear Door	112.0	116	113	107
13	Right Back Panel	107.3	115	103	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (R) Rear Trim - Worked - Small / (L) Rear Trim - Worked - Small	Remarks (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

Gap at front and rear bumper. With warranty booklet, spare tire, jack and seat cover. Without tools. 1 key. With LTO plate.