

General Information

Date & Time: 14, Nov, 2025 15:56

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	17,427
Registration No.	BAF7975-1	Chassis No.	PA1B18F39P422761
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



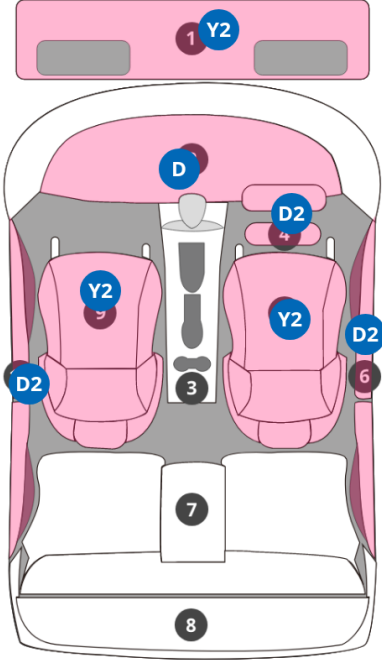
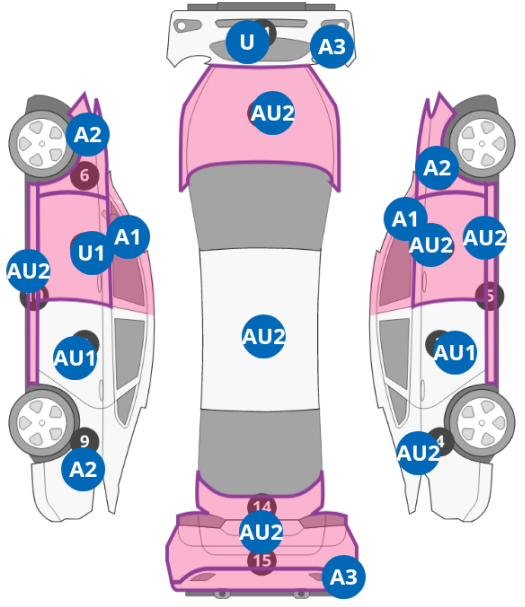
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	165.0	185	147	163
2	Boot Lid	115.0	118	107	120
3	Roof	95.1	102	97	89/93
4	Left Front Fender	90.9	92	88	93
5	Left Front Door	184.6	192	170	192
6	Center Panel Left				
7	Left Rear Door	102.1	104	97	105
8	Left Back Panel	103.3	103	106	101
9	Right Front Fender	103.0	105	100	104
10	Right Front Door	104.3	103	106	104
11	Center Panel Right				
12	Right Rear Door	146.3	145	141	153
13	Right Back Panel	103.8	105	98	109

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes
Frame Evaluation : D	Functional Evaluation : A
Remarks Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, no reverse camera, foul smell, worn tires and Sparetire, Scratch headlight and tail light.