

General Information

Date & Time: 17, Nov, 2025 09:32

Make	Toyota	Model	Vios
YOM	2019	Odo Meter Reading	22,718
Registration No.	GAJ7937	Chassis No.	PA1B13F34J4072925
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



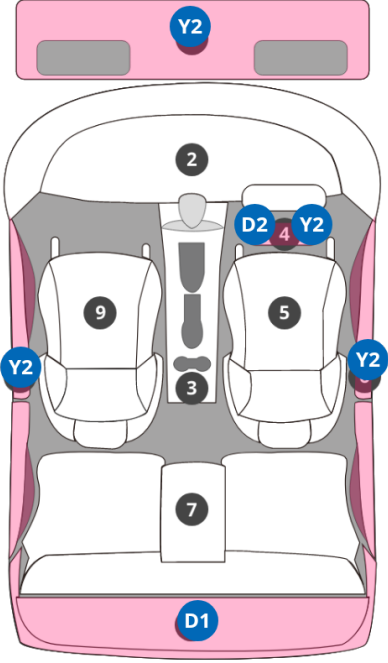
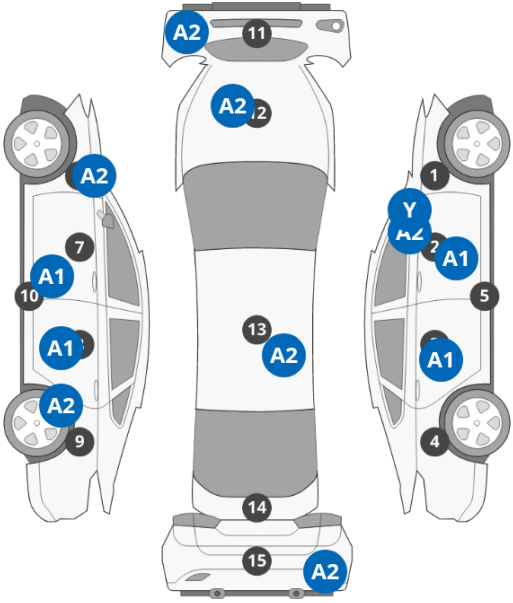
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	187.6	195	188	180
2	Boot Lid	140.0	141	132	147
3	Roof	152.2	152	158	146/153
4	Left Front Fender	152.3	155	153	149
5	Left Front Door	149.6	144	141	164
6	Center Panel Left				
7	Left Rear Door	143.3	164	134	132
8	Left Back Panel	239.3	187	366	165
9	Right Front Fender	158.0	202	130	142
10	Right Front Door	144.3	160	139	134
11	Center Panel Right				
12	Right Rear Door	147.3	158	132	152
13	Right Back Panel	171.0	149	137	227

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Trunk Room - Worked - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Room Mirror - Missing - Yes</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Mirror - Crack - Damaged / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Missing Rear view mirror. Right side mirror issue. Without warranty booklet, spare tire and tools. With jack and seat cover. 1 key. No LTO plate.</p>