

General Information

Date & Time: 17, Nov, 2025 15:45

Make	Nissan	Model	Navara
YOM	2020	Odo Meter Reading	79,825
Registration No.	LAG5480	Chassis No.	MNTCC2D23Z0075164
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



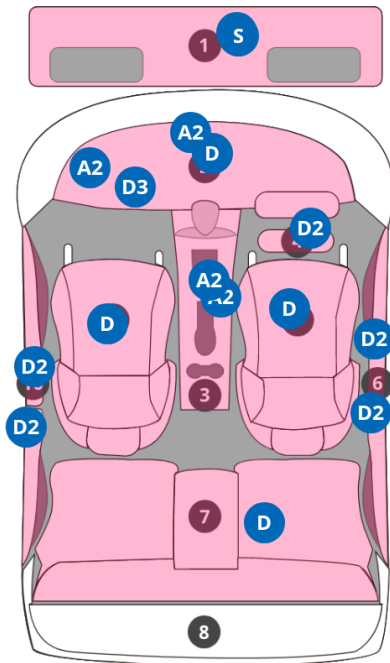
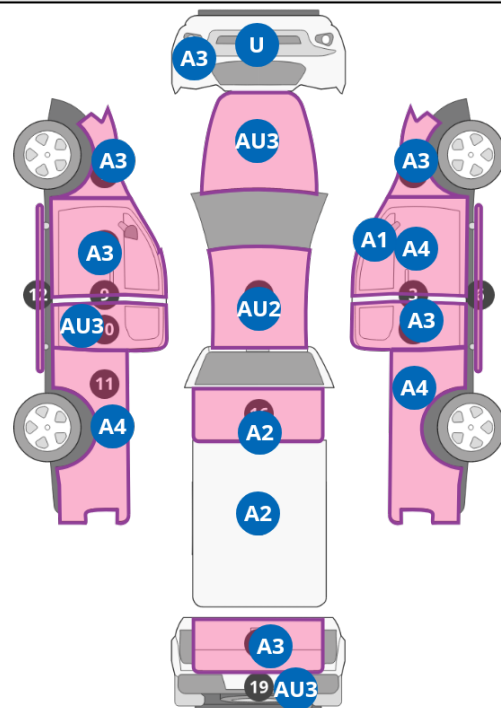
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	827.3	706	1,278	498
2	Boot Lid	184.6	174	233	147
3	Roof	185.4	187	82	278/195
4	Left Front Fender	484.3	646	455	352
5	Left Front Door	166.3	214	141	144
6	Center Panel Left				
7	Left Rear Door	245.0	240	236	259
8	Left Back Panel	532.0	192	754	650
9	Right Front Fender	373.6	174	481	466
10	Right Front Door	262.3	241	313	233
11	Center Panel Right				
12	Right Rear Door	281.3	274	279	291
13	Right Back Panel	278.3	310	277	248

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Glove Box - Loose, Deformed - Medium / Steering Wheel - Worn, Peel, Crack - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Knobs - Worn, Peel, Crack - Small / Room Mirror - Stuck - Yes / Display, Audio System - Stuck - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Replaced - Yes / Rear Gate - Repair mark - Yes / (L) Side Gate - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Side Gate - Repair mark - Yes / Roof - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / Cab Back Panel - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Side Gate - Scratch - Large / Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Side Gate - Scratch - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch & Dent - Small / Cab Back Panel - Scratch - Small / Cargo Bed Floor - Scratch - Small
Frame Evaluation : D	Functional Evaluation : E
Remarks Right Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate, No warranty booklet and Spare tire and Jack and Tools, No Spare key, no reverse camera, foul smell, possible flooded, warning lamps on, headlight issue, plate light issue, Room light issue, tail light busted and crack and gap, worn tires, adhesive marks on vehicle, rear bumper missing, power window issue, Abnormal vibration and Sound on engine, air-conditioned issue.