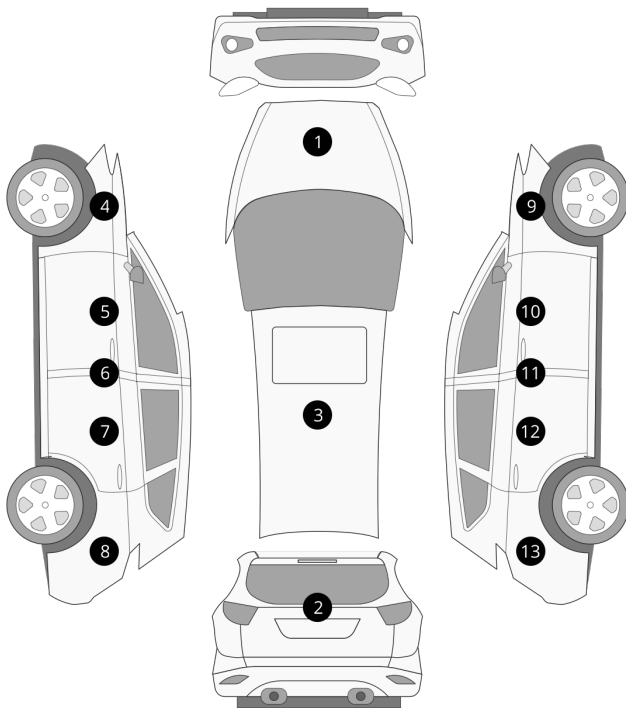


General Information

Date & Time: 15, Nov, 2025 10:11

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	11,520
Registration No.	BAG8897	Chassis No.	PA1B18F35R4281115
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



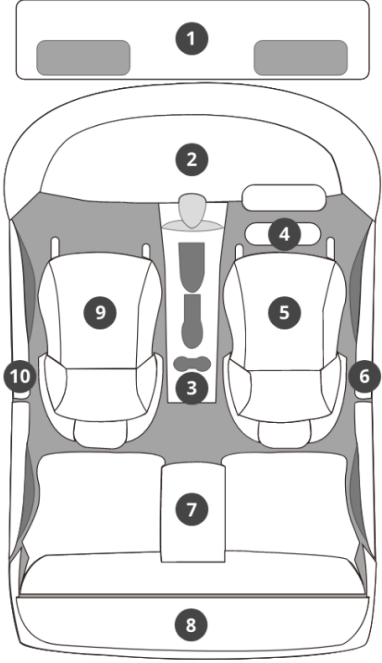
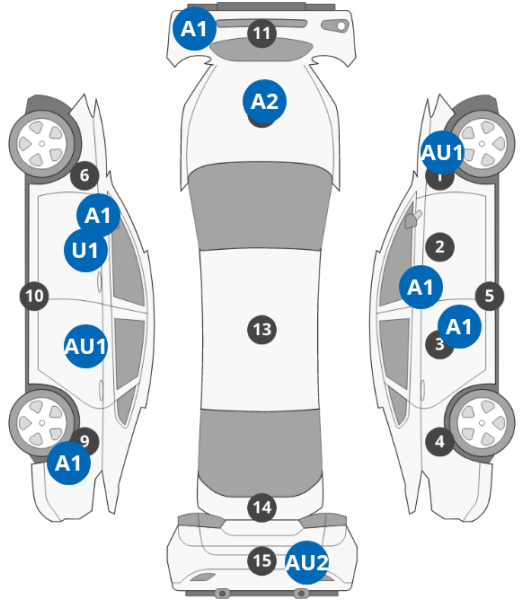
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	124	109	123
2	Boot Lid	106.0	101	105	112
3	Roof	109.7	121	108	97/113
4	Left Front Fender	155.0	190	141	134
5	Left Front Door	153.0	176	134	149
6	Center Panel Left				
7	Left Rear Door	108.6	116	105	105
8	Left Back Panel	107.0	124	97	100
9	Right Front Fender	105.6	103	107	107
10	Right Front Door	101.6	103	102	100
11	Center Panel Right				
12	Right Rear Door	108.8	119	99	108
13	Right Back Panel	113.6	109	104	128

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Dent - Minimal / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with jack and tools, 1key,no warranty booklet and spare tire,headlight bulb missing