

General Information

Date & Time: 17, Nov, 2025 12:43

Make	Toyota	Model	FJ Cruiser
YOM	2015	Odo Meter Reading	35,579
Registration No.	ABN3172	Chassis No.	JTEBU11F1FK216910
CC	4.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	White		

Body / Panel Condition



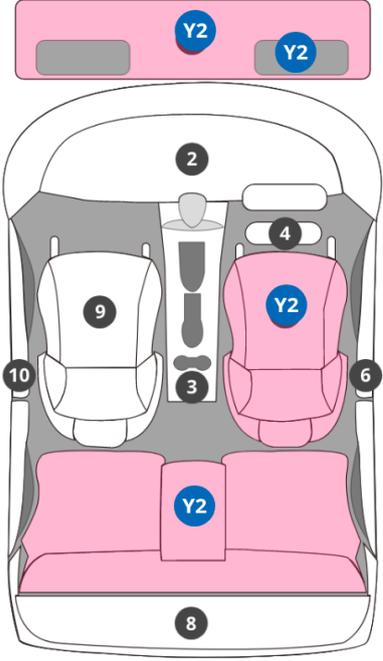
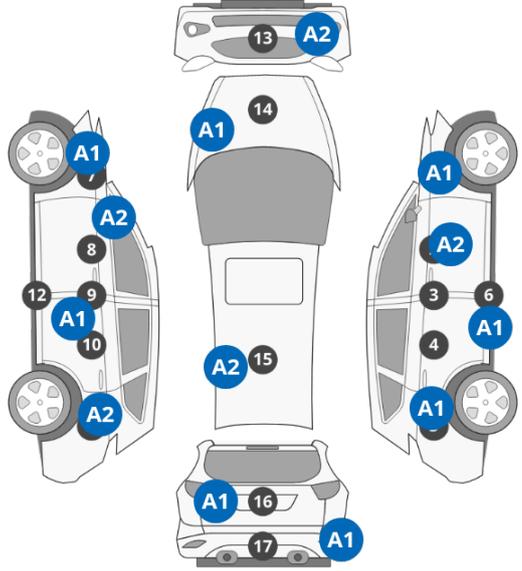
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	110	104	107
2	Boot Lid	109.0	106	111	110
3	Roof	99.9	106	94	100/100
4	Left Front Fender	105.0	110	99	106
5	Left Front Door	104.3	103	108	102
6	Center Panel Left				
7	Left Rear Door	105.3	100	108	108
8	Left Back Panel	104.2	110	97	106
9	Right Front Fender	112.6	113	108	117
10	Right Front Door	107.3	102	110	110
11	Center Panel Right				
12	Right Rear Door	110.0	113	110	107
13	Right Back Panel	108.0	103	107	114

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Seat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small / Rear Seat - Grime - Small</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Aircon issue. With warranty booklet, spare tire and jack. Without tools and seat cover. 1 key. With LTO plate.</p>