

General Information

Date & Time: 15, Nov, 2025 10:10

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	8,580
Registration No.	NGL7290	Chassis No.	PA1B18F35M4137508
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



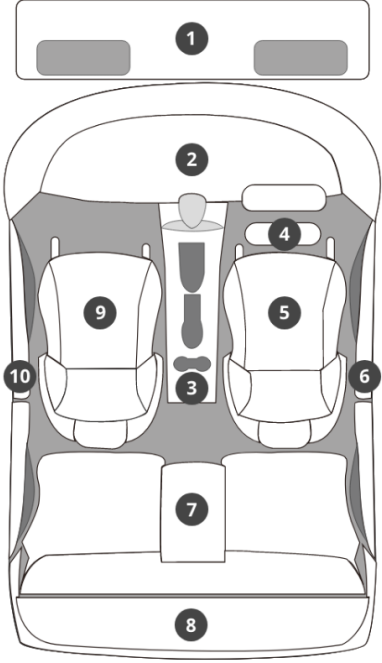
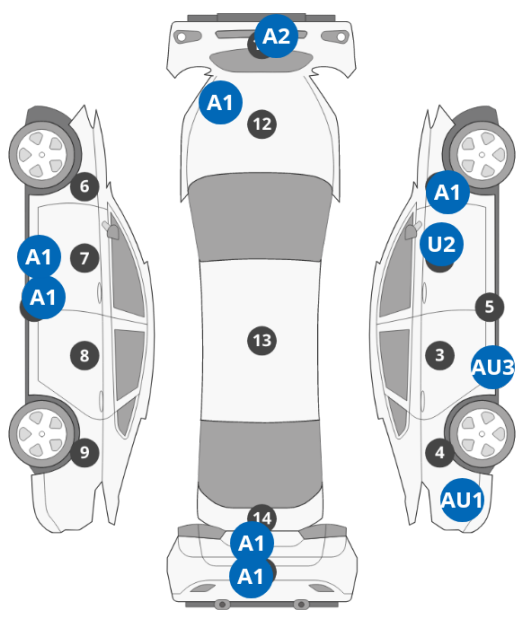
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	119	105	113
2	Boot Lid	106.6	106	110	104
3	Roof	100.6	112	100	95/96
4	Left Front Fender	127.3	127	144	111
5	Left Front Door	96.4	97	100	92
6	Center Panel Left				
7	Left Rear Door	97.3	100	96	96
8	Left Back Panel	109.3	112	107	109
9	Right Front Fender	95.0	99	99	88
10	Right Front Door	99.0	99	100	98
11	Center Panel Right				
12	Right Rear Door	98.5	98	92	106
13	Right Back Panel	99.2	100	98	100

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with warranty booklet, with jack, 1key, no spare tire and tools,