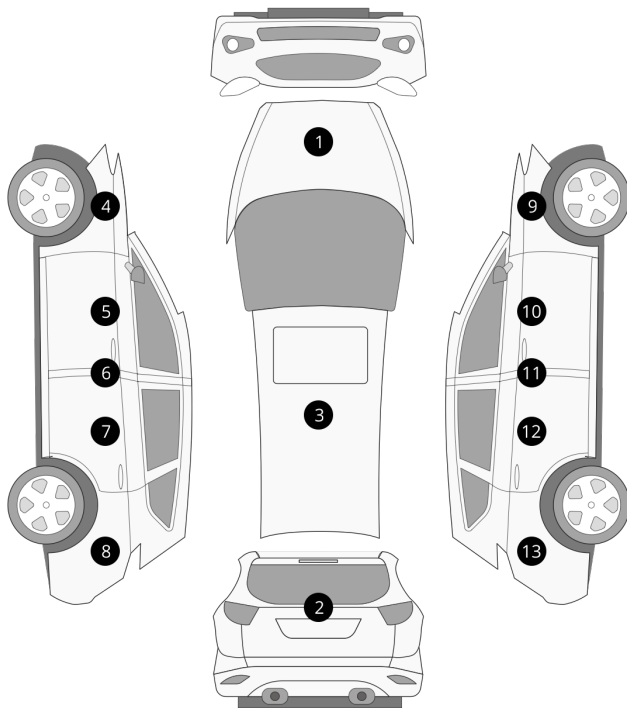


General Information

Date & Time: 15, Nov, 2025 11:05

Make	Toyota	Model	Raize
YOM	2024	Odo Meter Reading	17,829
Registration No.	CCK2503	Chassis No.	MHKAB1BA2RJ093661
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



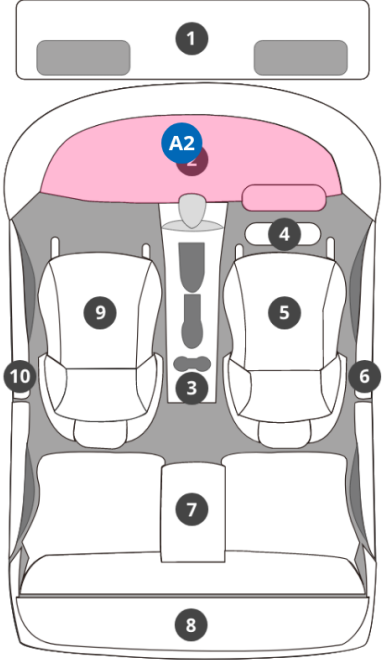
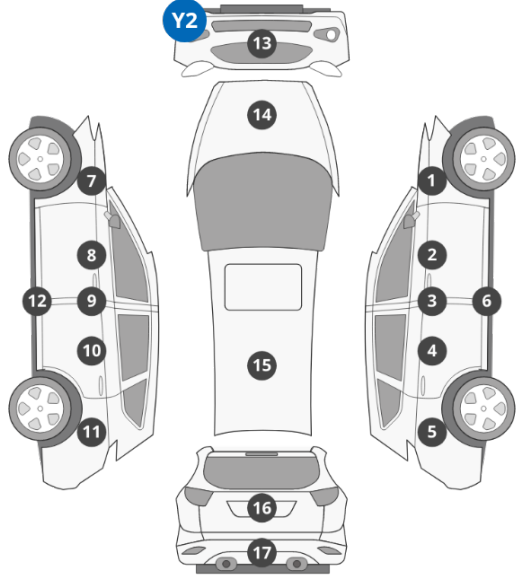
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	101	109	109
2	Boot Lid	74.6	73	86	65
3	Roof	98.5	95	95	100/105
4	Left Front Fender	85.4	89	97	71
5	Left Front Door	96.6	100	98	92
6	Center Panel Left				
7	Left Rear Door	89.7	91	92	86
8	Left Back Panel	78.7	77	76	83
9	Right Front Fender	87.0	96	90	76
10	Right Front Door	84.8	91	89	75
11	Center Panel Right				
12	Right Rear Door	99.1	95	103	100
13	Right Back Panel	80.4	85	76	81

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks Front Bumper, Grille, Lamps - Crack, Gap - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with warranty booklet, 1key, with jack and spare tire, no tools, scratches on headlight, dirt mark on exterior