

General Information

Date & Time: 15, Nov, 2025 15:54

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	38,060
Registration No.	CCD1313	Chassis No.	PA1B18F35R4243920
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



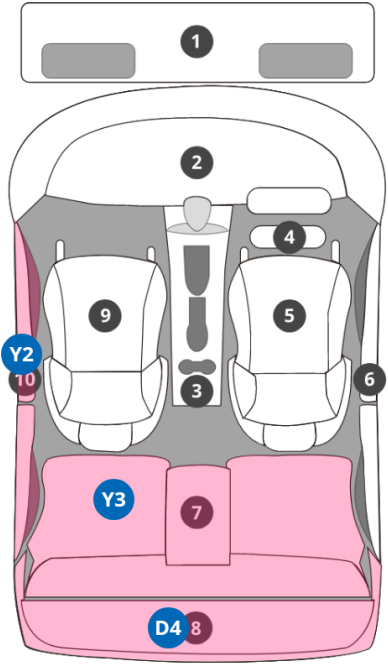
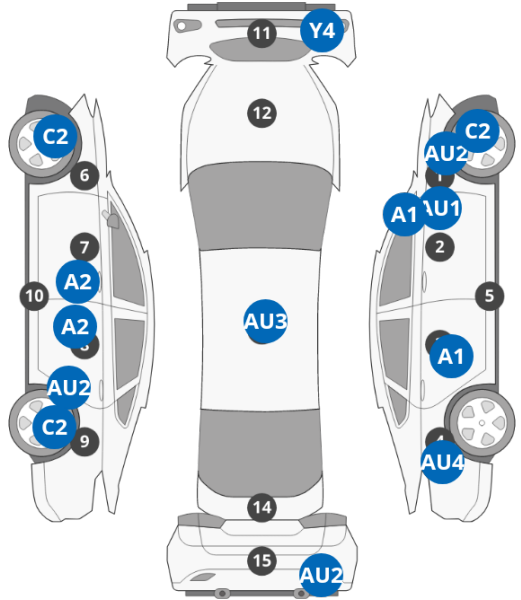
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	109	108	112
2	Boot Lid	105.3	105	104	107
3	Roof	101.2	106	99	93/107
4	Left Front Fender	98.7	96	100	100
5	Left Front Door	94.3	97	95	92
6	Center Panel Left				
7	Left Rear Door	106.7	121	101	98
8	Left Back Panel	104.6	104	105	105
9	Right Front Fender	103.3	105	103	102
10	Right Front Door	99.6	103	95	101
11	Center Panel Right				
12	Right Rear Door	107.7	99	106	118
13	Right Back Panel	104.5	113	104	97

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / Trunk Room - Worked - Large / Rear Seat - Grime - Medium</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes
<p>With Lto plate, with jack and spare tire, no warranty booklet and tools, 1key, scratches on headlight,</p>