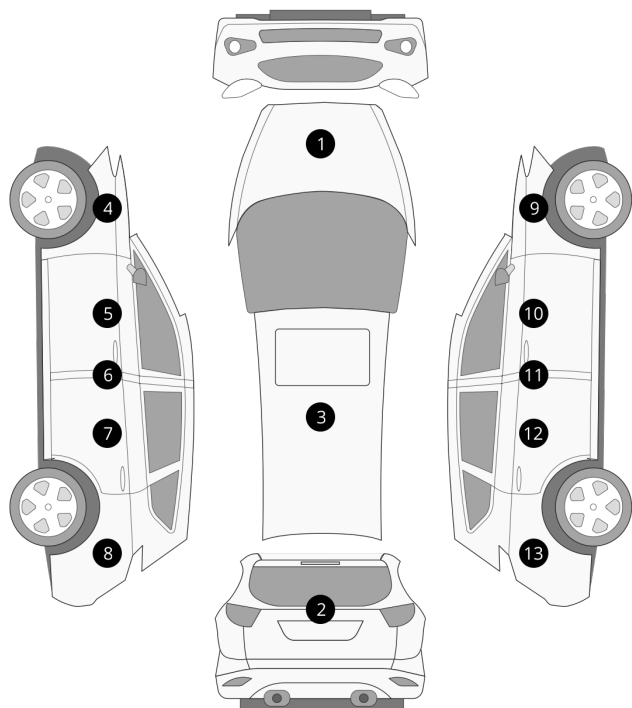


General Information

Date & Time: 15, Nov, 2025 15:54

Make	Toyota	Model	Raize
YOM	2023	Odo Meter Reading	38,801
Registration No.	CBT1146	Chassis No.	MHKAA1BAANJ065202
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Pearl White		

Body / Panel Condition



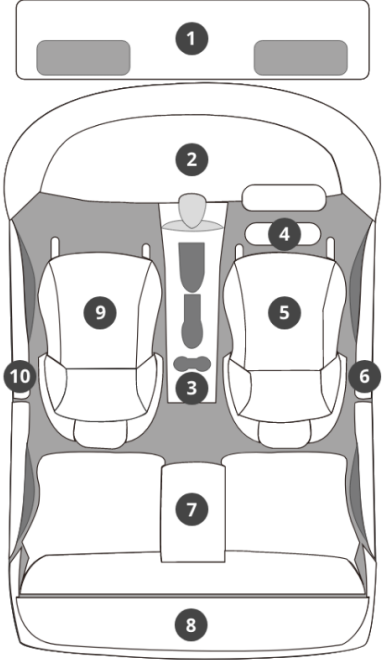
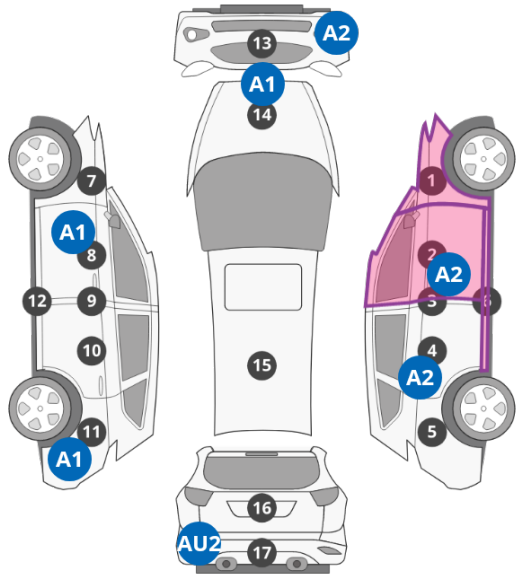
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	258.6	322	162	292
2	Boot Lid	155.6	155	165	147
3	Roof	88.1	97	93	80/83
4	Left Front Fender	192.0	171	184	221
5	Left Front Door	183.0	215	159	175
6	Center Panel Left				
7	Left Rear Door	174.0	179	147	196
8	Left Back Panel	159.6	174	143	162
9	Right Front Fender	374.3	705	223	195
10	Right Front Door	529.0	231	215	1,141
11	Center Panel Right				
12	Right Rear Door	168.3	165	147	193
13	Right Back Panel	157.6	164	145	164

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Difference in Color / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with warranty booklet, with jack and spare tire, 1 key, no tools, scratches headlight,