

General Information

Date & Time: 15, Nov, 2025 15:53

Make	Toyota	Model	Raize
YOM	2023	Odo Meter Reading	32,744
Registration No.	CBI7509	Chassis No.	MHKAA1BA3PJ075203
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Pearl White		

Body / Panel Condition



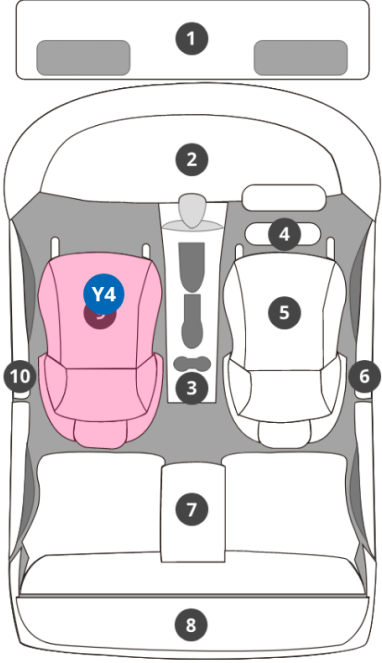
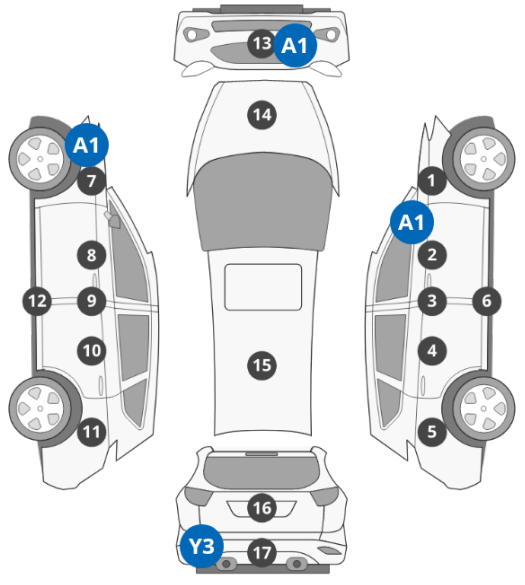
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	120	109	95
2	Boot Lid	93.7	88	105	88
3	Roof	89.5	101	93	79/85
4	Left Front Fender	89.5	91	98	80
5	Left Front Door	93.8	94	97	91
6	Center Panel Left				
7	Left Rear Door	94.5	95	95	93
8	Left Back Panel	90.5	86	85	100
9	Right Front Fender	102.0	101	112	93
10	Right Front Door	102.5	99	103	106
11	Center Panel Right				
12	Right Rear Door	97.6	94	97	102
13	Right Back Panel	83.8	86	87	79

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Large	Remarks (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
With Lto plate, with warranty booklet, with spare tire and jack, no tools, 2 keys, Crack tail light, scratches headlight