

General Information

Date & Time: 17, Nov, 2025 15:38

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	31,170
Registration No.	CAZ9236	Chassis No.	PA1B18F37R4240288
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



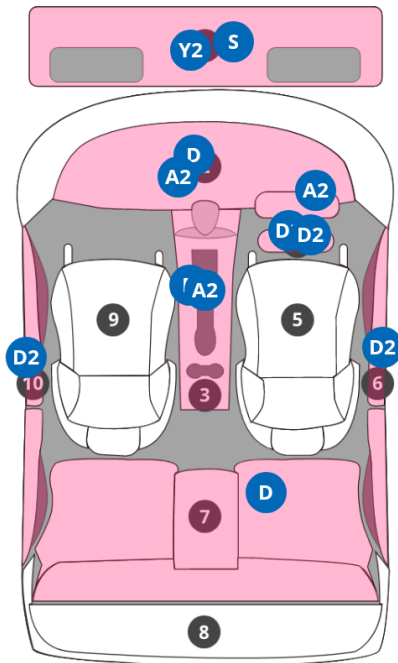
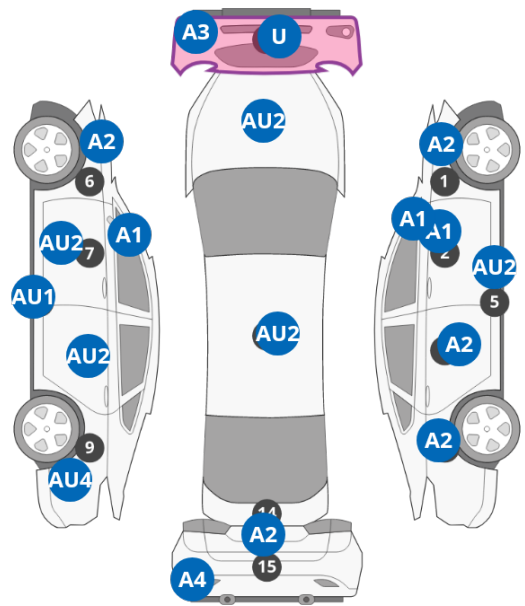
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	109	107	107
2	Boot Lid	101.2	101	100	103
3	Roof	92.5	99	94	89/89
4	Left Front Fender	92.7	93	94	91
5	Left Front Door	101.6	102	103	100
6	Center Panel Left				
7	Left Rear Door	97.8	102	101	91
8	Left Back Panel	107.0	111	106	104
9	Right Front Fender	95.5	92	94	100
10	Right Front Door	102.0	100	106	100
11	Center Panel Right				
12	Right Rear Door	97.6	93	97	103
13	Right Back Panel	103.2	100	103	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Glove Box - Worn, Scratch, Cut, Crack - Small / Rear Seat - Worn - Yes	Remarks Member (Bolted) - Dent - Yes / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, No warranty booklet and Sparetire and Jack and Tools, No Spare key, Scratch headlight and tail light, Worn Tires, adhesive marks on vehicle, foul smell,worn tires.