

General Information

Date & Time: 17, Nov, 2025 15:39

Make	Toyota	Model	Innova
YOM	2021	Odo Meter Reading	128,610
Registration No.	CMB5649	Chassis No.	PA2JA8EM9M0089052
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



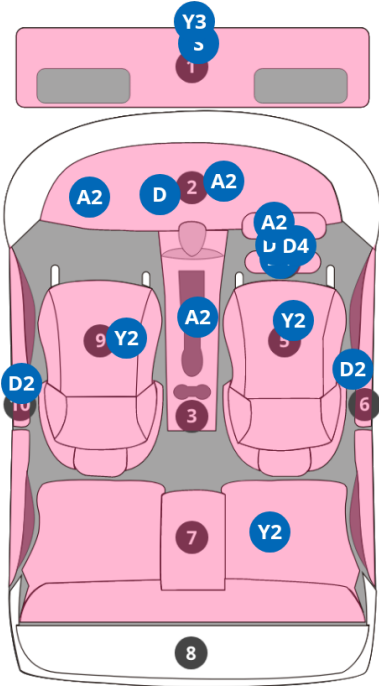
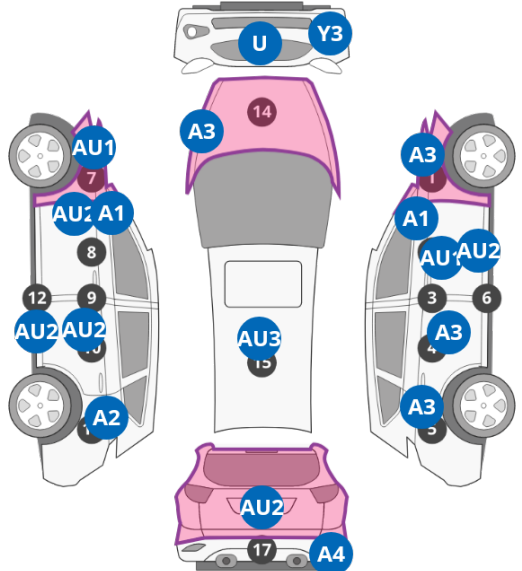
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.5	98	146	88
2	Boot Lid	106.3	101	110	108
3	Roof	98.3	93	90	110/100
4	Left Front Fender	100.2	109	102	90
5	Left Front Door	102.4	110	102	95
6	Center Panel Left				
7	Left Rear Door	101.1	101	99	103
8	Left Back Panel	105.6	108	106	103
9	Right Front Fender	108.0	112	105	107
10	Right Front Door	109.3	102	111	115
11	Center Panel Right				
12	Right Rear Door	108.3	103	113	109
13	Right Back Panel	109.3	104	110	114

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Ceiling - Grime - Medium / Mat Other - Worked - Large / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Large / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch - Medium / Roof - Scratch & Dent - Medium
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak

Inspector Notes
With LTO plate and Spare tire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, Worn Tires and Spare tire, foul smell, possible flooded, warning lamps on, Aircon issue, Room light issue, plate light issue, no reverse camera.