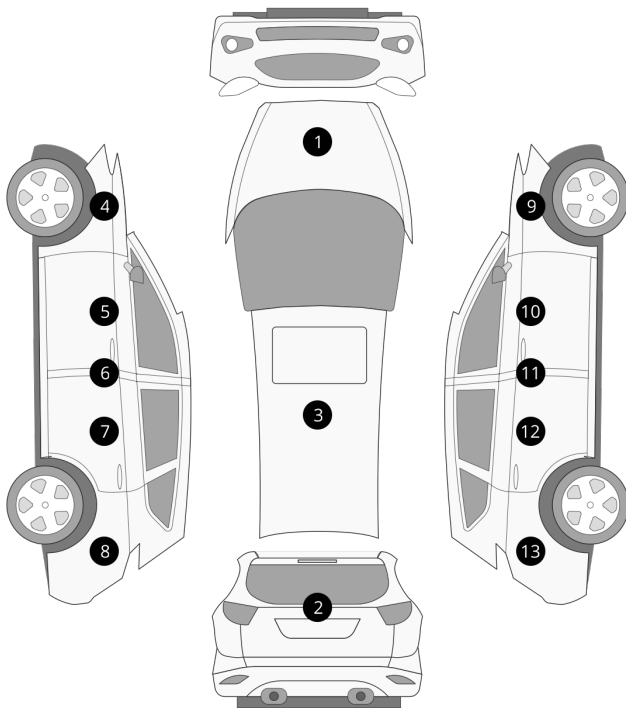


General Information

Date & Time: 17, Nov, 2025 15:38

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	7,318
Registration No.	NKL2177	Chassis No.	MHFAA1BY0R0036010
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



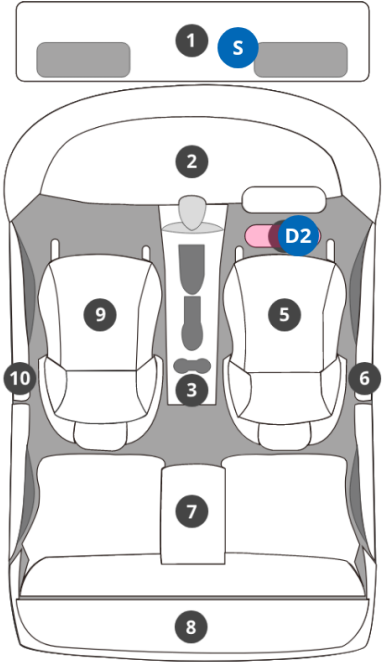
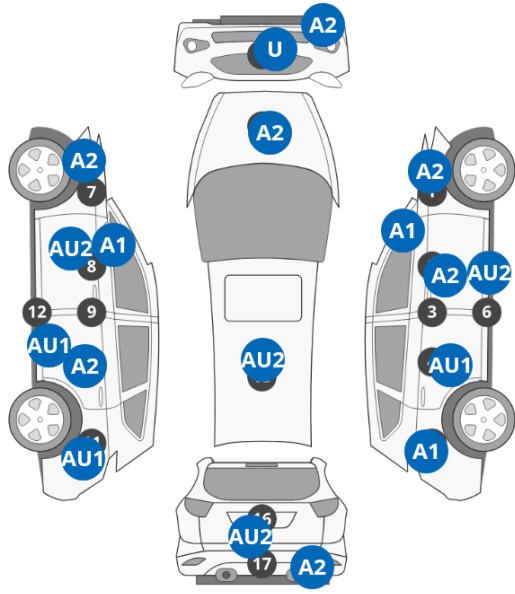
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	108	113	119
2	Boot Lid	97.2	93	101	98
3	Roof	126.2	130	120	124/131
4	Left Front Fender	98.5	97	102	96
5	Left Front Door	118.6	110	122	124
6	Center Panel Left				
7	Left Rear Door	113.0	115	105	119
8	Left Back Panel	114.8	126	119	99
9	Right Front Fender	100.5	99	106	97
10	Right Front Door	115.6	121	115	111
11	Center Panel Right				
12	Right Rear Door	110.6	117	105	110
13	Right Back Panel	114.6	102	117	125

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes	Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, worn tires, Scratch headlight and tail light, foul smell.