

General Information

Date & Time: 20, Nov, 2025 16:03

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	21,906
Registration No.	NKJ2959	Chassis No.	PA1B18F33R4263485
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



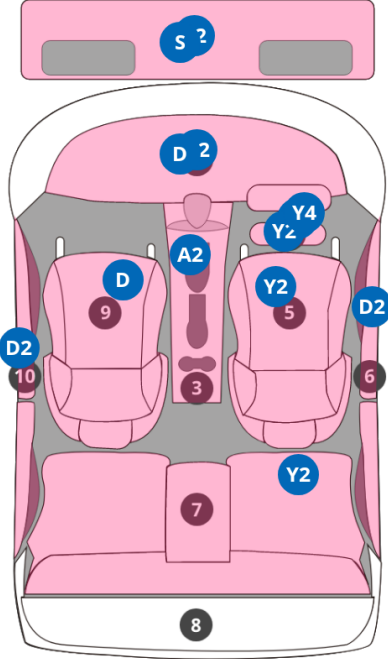
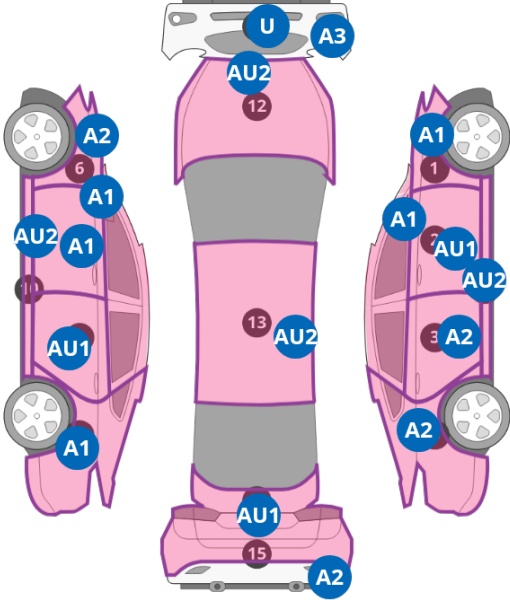
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	111	105	118
2	Boot Lid	106.6	108	104	108
3	Roof	100.3	107	105	95/94
4	Left Front Fender	164.6	176	140	178
5	Left Front Door	150.0	156	136	158
6	Center Panel Left				
7	Left Rear Door	233.0	248	223	228
8	Left Back Panel	214.0	253	205	184
9	Right Front Fender	102.2	102	96	109
10	Right Front Door	97.4	97	95	100
11	Center Panel Right				
12	Right Rear Door	97.0	93	96	102
13	Right Back Panel	111.0	108	107	118

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Large / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / Roof - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal</p>
Frame Evaluation : D	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Center Pillar - Condition of Welding ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

with LTO plate, No warranty booklet and Spare tire and Jack and Tools, No Spare key, Scratch headlight and tail light, Worn Tires, foul smell, possible flooded.