

General Information

Date & Time: 19, Nov, 2025 15:58

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	26,033
Registration No.	NHM3630	Chassis No.	MHFAB1BY5P3075720
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



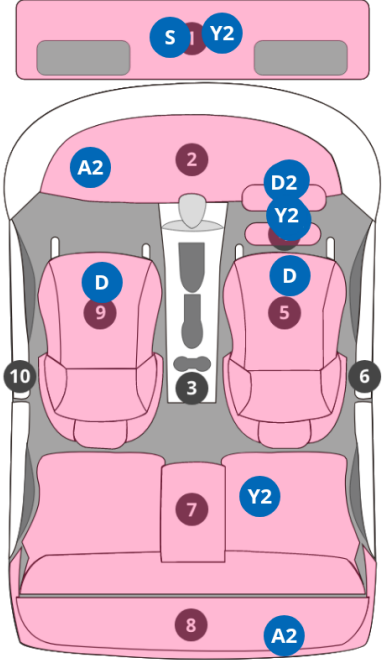
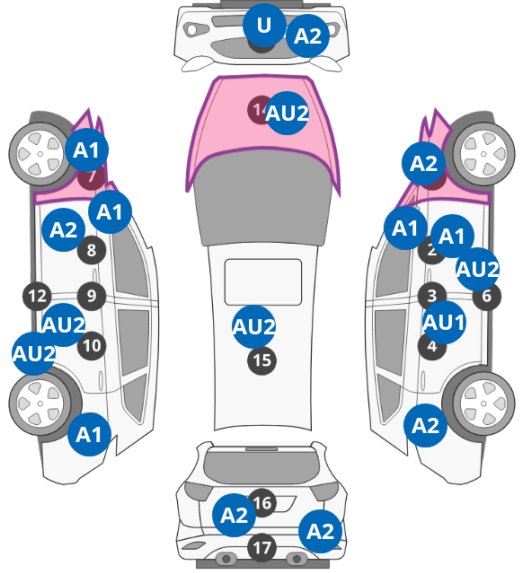
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	104	110	114
2	Boot Lid	104.0	99	111	102
3	Roof	123.2	123	130	119/121
4	Left Front Fender	112.0	108	111	117
5	Left Front Door	136.0	127	139	142
6	Center Panel Left				
7	Left Rear Door	114.6	115	110	119
8	Left Back Panel	110.3	116	118	97
9	Right Front Fender	103.6	103	108	100
10	Right Front Door	120.3	124	123	114
11	Center Panel Right				
12	Right Rear Door	114.6	116	112	116
13	Right Back Panel	107.6	98	110	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Glove Box - Loose, Deformed - Small / Steering Wheel - Worn, Peel, Crack - Small / Overall Interior - Smell - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Rear Seat - Grime - Small / Mat Other - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, worn tires and Sparetire, Scratch headlight and tail light, foul smell.</p>