

General Information

Date & Time: 17, Nov, 2025 10:48

Make	Toyota	Model	RAV4
YOM	2018	Odo Meter Reading	66,997
Registration No.	GAG1192	Chassis No.	JTMZF9EV7HJ156539
CC	2.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



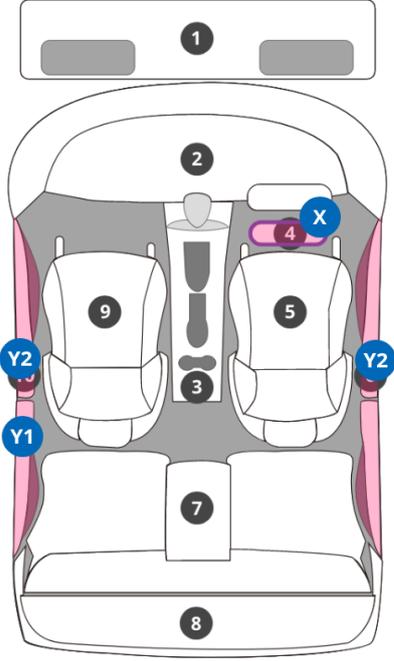
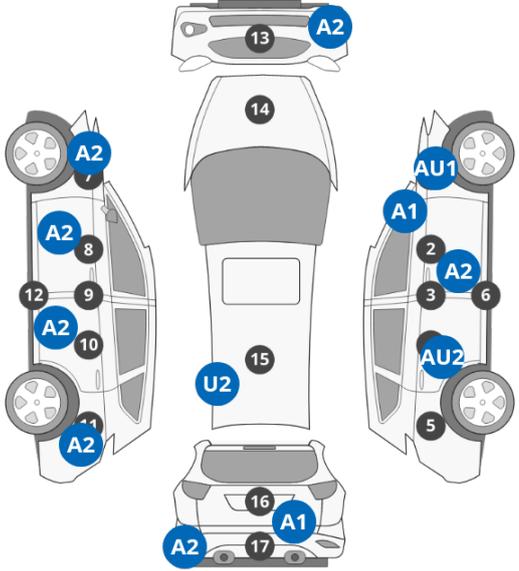
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	101	102	107
2	Boot Lid	109.6	103	122	104
3	Roof	99.0	90	96	107/103
4	Left Front Fender	112.0	111	120	105
5	Left Front Door	105.3	103	105	108
6	Center Panel Left				
7	Left Rear Door	102.8	109	101	98
8	Left Back Panel	104.3	107	106	100
9	Right Front Fender	113.0	113	118	108
10	Right Front Door	162.0	182	160	144
11	Center Panel Right				
12	Right Rear Door	244.3	261	216	256
13	Right Back Panel	152.6	188	135	135

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Overall Exterior - Faded(Color, Gloss) - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / Roof - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet. With spare tire,jack,tools and leather seat cover. 1 key. With LTO plate.</p>