

General Information

Date & Time: 19, Nov, 2025 14:32

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	46,666
Registration No.	NHR8186	Chassis No.	PA1B18F37P4230731
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



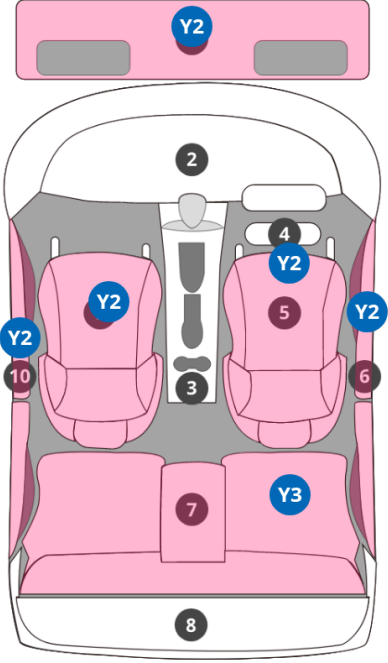
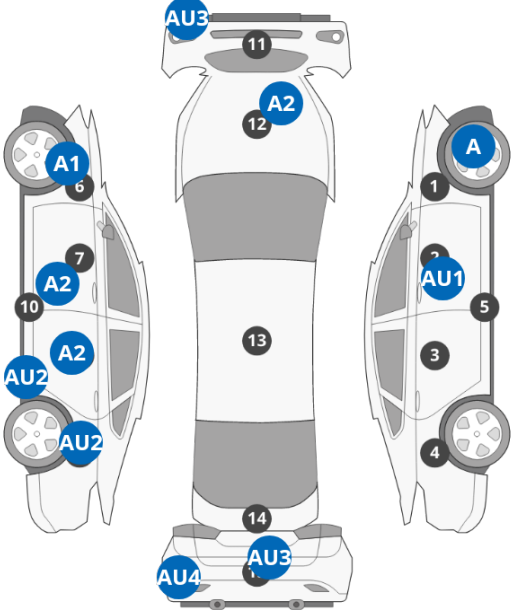
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	115	108	106
2	Boot Lid	99.1	94	102	101
3	Roof	102.1	103	104	97/105
4	Left Front Fender	105.3	109	103	104
5	Left Front Door	105.3	103	109	104
6	Center Panel Left				
7	Left Rear Door	107.3	114	112	96
8	Left Back Panel	105.2	110	100	106
9	Right Front Fender	132.6	142	127	129
10	Right Front Door	203.6	212	164	235
11	Center Panel Right				
12	Right Rear Door	213.6	220	173	248
13	Right Back Panel	166.0	130	174	194

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Tyre - Crack, Cut - Yes / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, 1key, No spare tire, no jack and tools, foul smell, scratches on headlights, traces of adhesive on windshield</p>