

General Information

Date & Time: 17, Nov, 2025 11:20

Make	Lexus	Model	LS 460
YOM	2012	Odo Meter Reading	49,258
Registration No.	MSY08	Chassis No.	JTHGL46F305046559
CC	4.6	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



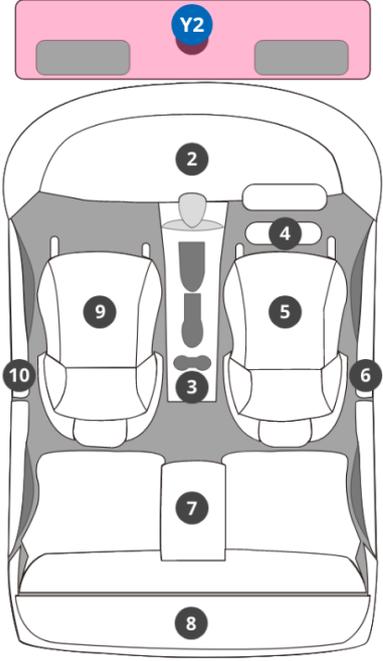
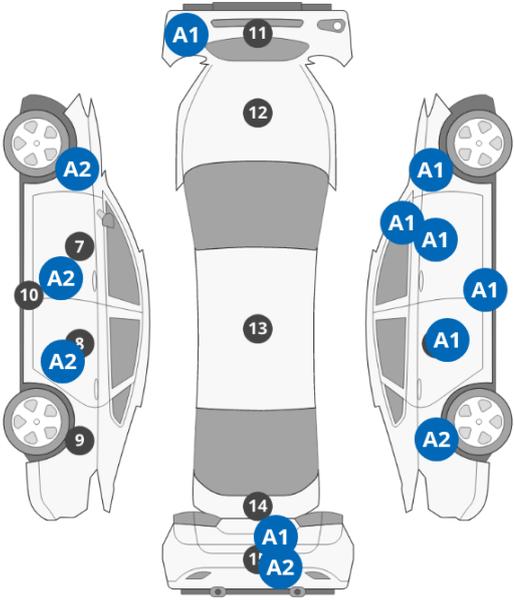
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	183.0	181	179	189
2	Boot Lid	164.6	161	162	171
3	Roof	169.7	185	174	160/160
4	Left Front Fender	166.0	174	168	156
5	Left Front Door	164.3	171	168	154
6	Center Panel Left				
7	Left Rear Door	168.0	167	174	163
8	Left Back Panel	281.6	275	292	278
9	Right Front Fender	161.6	134	166	185
10	Right Front Door	168.3	152	174	179
11	Center Panel Right				
12	Right Rear Door	155.0	142	161	162
13	Right Back Panel	154.0	169	149	144

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Small	Remarks Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Without warranty booklet and tools. With spae tire and jack. 1 key. LTO plate not installed.