

General Information

Date & Time: 17, Nov, 2025 15:37

Make	Toyota	Model	Vios
YOM	2015	Odo Meter Reading	35,435
Registration No.	ABJ6110	Chassis No.	NCP1512043923
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



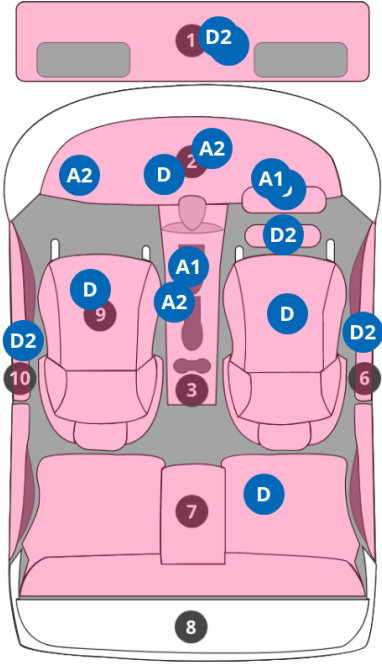
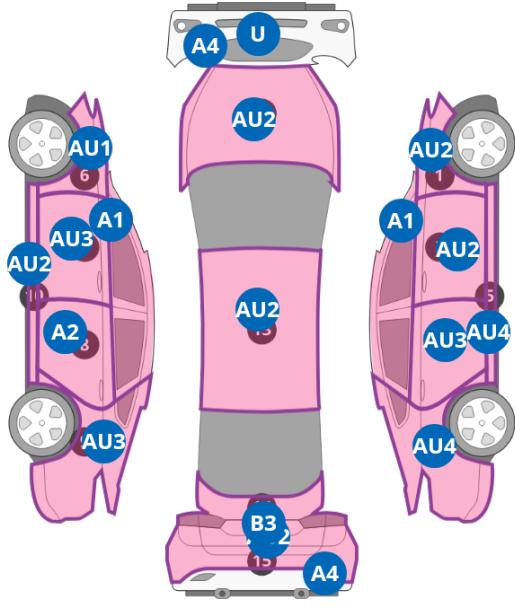
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	112	115	114
2	Boot Lid	139.3	138	144	136
3	Roof	146.9	225	97	108/158
4	Left Front Fender	264.3	222	257	314
5	Left Front Door	105.7	168	74	75
6	Center Panel Left				
7	Left Rear Door	239.6	270	272	177
8	Left Back Panel	292.6	498	198	182
9	Right Front Fender	113.5	100	116	125
10	Right Front Door	180.6	173	206	163
11	Center Panel Right				
12	Right Rear Door	162.3	269	117	101
13	Right Back Panel	278.6	251	192	393

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Traces of Adhesive Tape - Yes / Glove Box - Worn, Scratch, Cut, Crack - Minimal / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Knobs - Worn, Peel, Crack - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Worn - Yes / Ceiling - Crinkle - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / Trunk Hood, Rear Gate - Modified - Medium / Overall Exterior - Faded(Color, Gloss) - Yes / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal
Frame Evaluation : D	Functional Evaluation : E
Remarks Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, no spare key, worn tires and Sparetire, Scratch and Crack Tail light, possible flooded, warning lamps on,Aircon issue, tail light and plate light busted, foglight issue and headlight bulb issue, Room light issue, power window switch issue.