

General Information

Date & Time: 20, Nov, 2025 13:27

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	84,826
Registration No.	DBI7123	Chassis No.	PA1B18F31P4215674
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



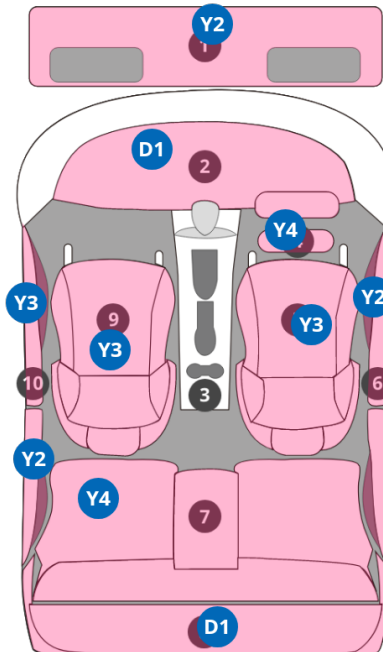
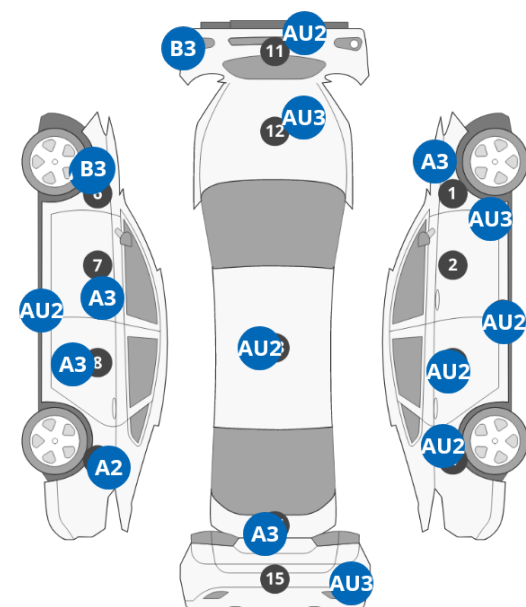
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.2	100	84	96
2	Boot Lid	115.0	97	130	118
3	Roof	92.2	96	96	91/86
4	Left Front Fender	150.0	147	145	158
5	Left Front Door	121.5	147	118	100
6	Center Panel Left				
7	Left Rear Door	99.1	102	96	100
8	Left Back Panel	107.6	117	107	99
9	Right Front Fender	103.9	103	99	110
10	Right Front Door	102.3	105	100	102
11	Center Panel Right				
12	Right Rear Door	150.3	142	149	160
13	Right Back Panel	114.6	112	104	128

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Large / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (L) Rear Trim - Grime - Small / Trunk Room - Worked - Minimal / Dashboard - Worked - Minimal / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Modified - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Modified - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with Warranty & Manual booklet, with spare tire, no spare key, no reverse camera, no tools, with jack, no LTO plate, scratches on taillight.</p>