

General Information

Date & Time: 20, Nov, 2025 13:16

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	59,886
Registration No.	DBO7497	Chassis No.	PA1B18F31R4252422
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



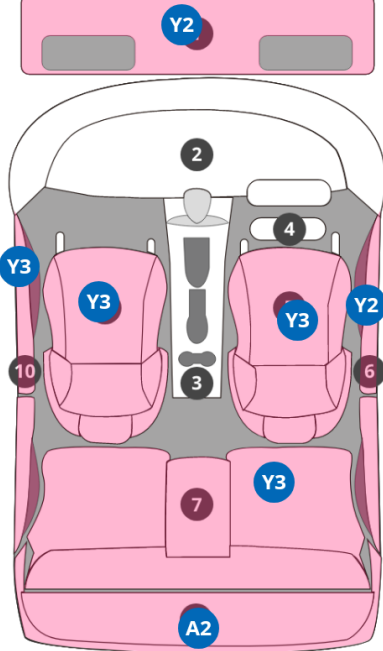
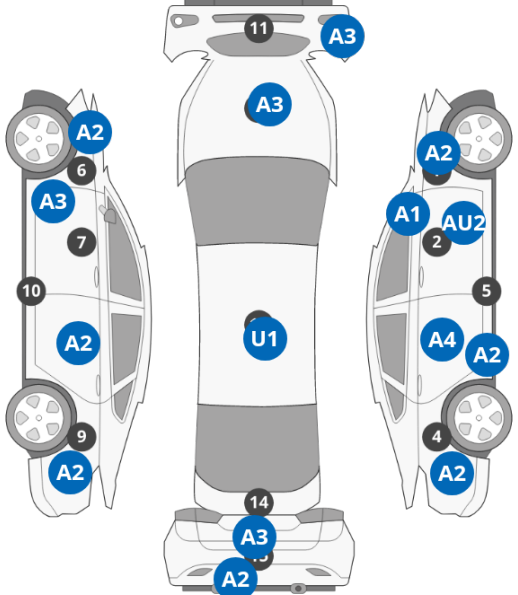
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	121	101	126
2	Boot Lid	103.8	99	107	105
3	Roof	97.7	105	97	96/93
4	Left Front Fender	101.1	95	103	105
5	Left Front Door	101.4	103	102	99
6	Center Panel Left				
7	Left Rear Door	111.0	120	106	107
8	Left Back Panel	115.3	123	117	106
9	Right Front Fender	100.6	99	101	102
10	Right Front Door	99.5	102	99	98
11	Center Panel Right				
12	Right Rear Door	103.4	99	100	111
13	Right Back Panel	107.4	98	101	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks Roof - Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with spare key/with reverse camera/with jack and incomplete tools/Dome light issue/with warranty booklet</p>