

General Information

Date & Time: 20, Nov, 2025 15:38

Make	Toyota	Model	Vios
YOM	2017	Odo Meter Reading	82,604
Registration No.	NAR5687	Chassis No.	PA1B19F34H4029411
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



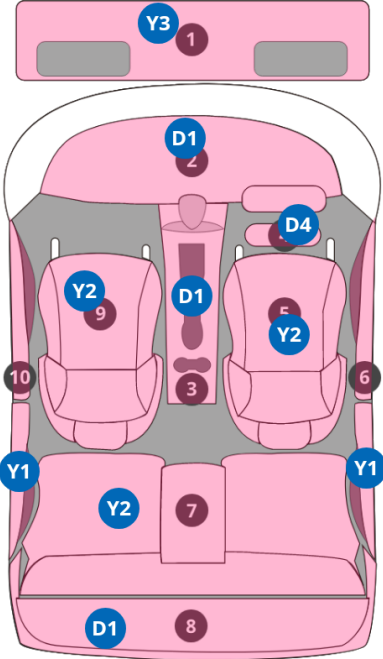
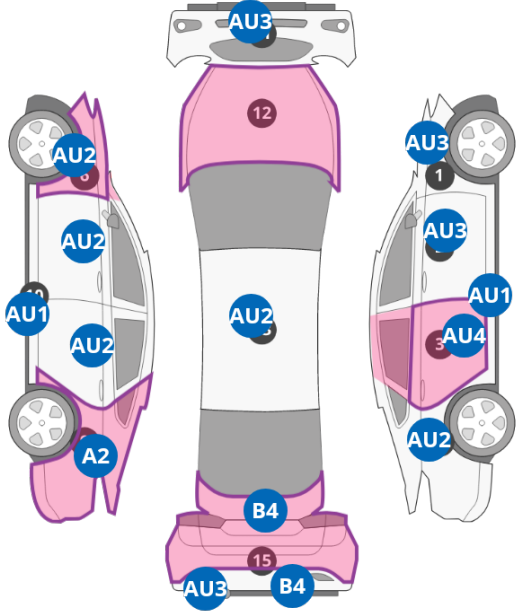
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	198.6	209	196	191
2	Boot Lid	190.3	185	209	177
3	Roof	114.0	105	119	112/120
4	Left Front Fender	161.3	173	163	148
5	Left Front Door	150.6	165	149	138
6	Center Panel Left				
7	Left Rear Door	124.3	117	121	135
8	Left Back Panel	129.0	138	117	132
9	Right Front Fender	128.0	141	117	126
10	Right Front Door	117.3	107	128	117
11	Center Panel Right				
12	Right Rear Door	191.0	203	207	163
13	Right Back Panel	239.6	224	223	272

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Large / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal / Dashboard - Worked - Minimal / Console, Switches, Vents - Worked - Minimal / (L) Rear Trim - Grime - Minimal / (R) Rear Trim - Grime - Minimal</p>	<p>Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Repair mark - Yes / Roof - Scratch & Dent - Small / Overall Exterior - Worn as per age - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Modified - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Modified - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal</p>
Frame Evaluation : D	Functional Evaluation : D
<p>Remarks Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with warranty booklet, reverse camera issue, left side speaker issue, fog & plate light issue, left side mirror issue, no tools & jack, no spare key, scratches on taillight.</p>