

General Information

Date & Time: 21, Nov, 2025 08:50

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	21,898
Registration No.	DBU3843	Chassis No.	PA1B18F32S4287458
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



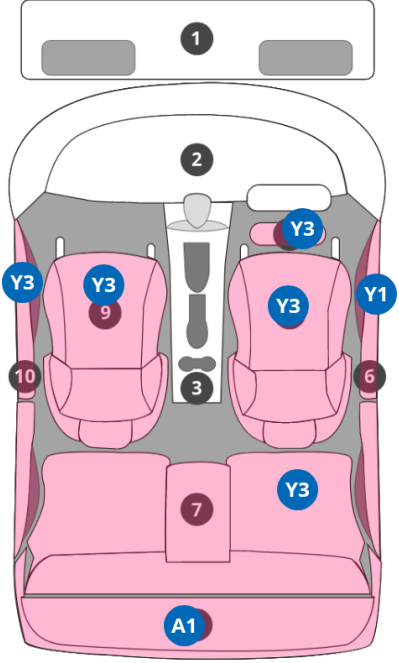
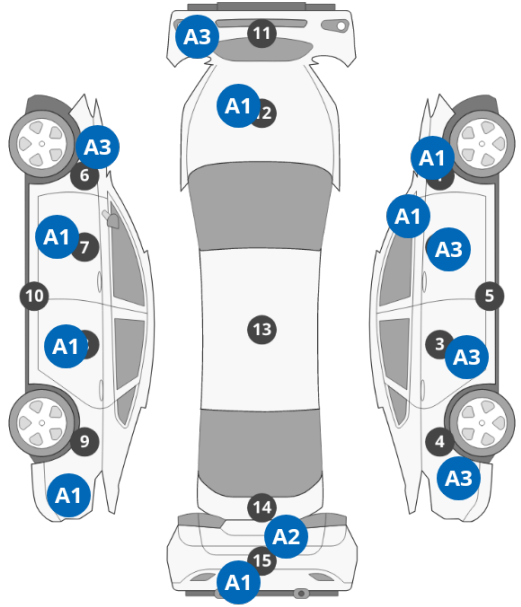
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.7	117	91	112
2	Boot Lid	107.8	100	108	116
3	Roof	92.8	93	96	84/98
4	Left Front Fender	98.8	100	99	97
5	Left Front Door	96.9	92	101	97
6	Center Panel Left				
7	Left Rear Door	97.4	101	97	94
8	Left Back Panel	107.3	110	108	104
9	Right Front Fender	99.7	99	99	101
10	Right Front Door	98.1	101	99	94
11	Center Panel Right				
12	Right Rear Door	104.4	113	96	104
13	Right Back Panel	104.5	104	99	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with jack No tools/with reverse camera/with warranty booklet/rear seat issue</p>