

## General Information

Date & Time: 21, Nov, 2025 09:52

<b>Make</b>	Toyota	<b>Model</b>	Lite Ace
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	150,462
<b>Registration No.</b>	NFO7652	<b>Chassis No.</b>	MHKU3FE10NK000413
<b>CC</b>	1.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Commercial Vehicles
<b>Colour</b>	White		

## Body / Panel Condition



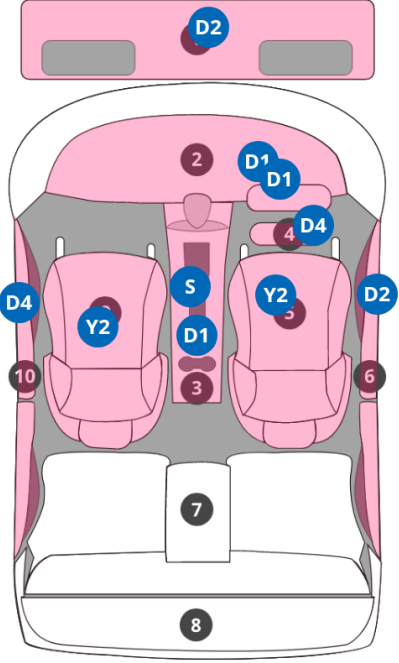
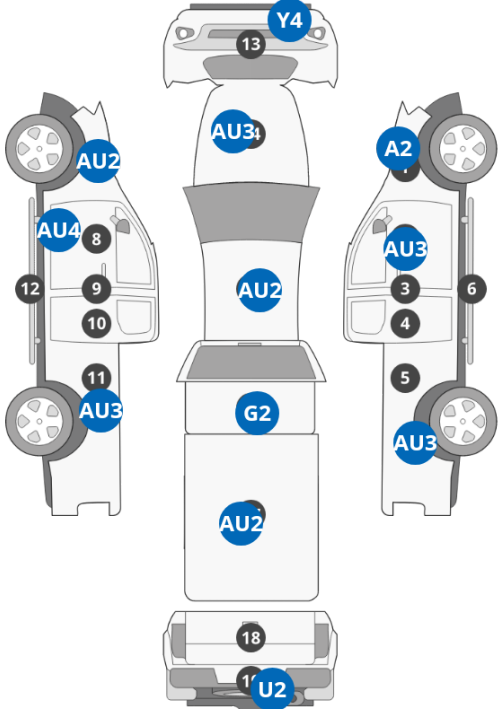
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	331.6	246	543	206
2	Boot Lid	5.9	10	4	4
3	Roof	56.7	50	61	57/59
4	Left Front Fender	164.6	106	131	257
5	Left Front Door	156.3	138	176	155
6	Center Panel Left	110.4	99	107	125
7	Left Rear Door				
8	Left Back Panel	16.4	27	4	18
9	Right Front Fender	196.6	276	125	189
10	Right Front Door	116.8	106	98	146
11	Center Panel Right	109.3	104	118	106
12	Right Rear Door				
13	Right Back Panel	6.8	13	4	4

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Crinkle - Small / (L) Front Trim - Worked - Large / (R) Front Trim - Worked - Small / Mat Other - Worked - Large / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Worked - Minimal / Console, Switches, Vents - Worked - Minimal / Overall Interior - Smell - Yes / Instrument Panel - Worked - Minimal</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (L) Front Door, Molding - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch &amp; Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Medium / Roof - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Guard Frame - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Dent - Small / (R) Guard Frame - Scratch &amp; Dent - Medium / Cab Back Panel - Scratch &amp; Dent - Small / Rear Windshield - Scratch, Stone chip - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with spare tire, with LTO plate, no tools &amp; jack, no warranty &amp; manual booklet, no spare key, no reverse camera, scratches on taillight &amp; headlight.</p>