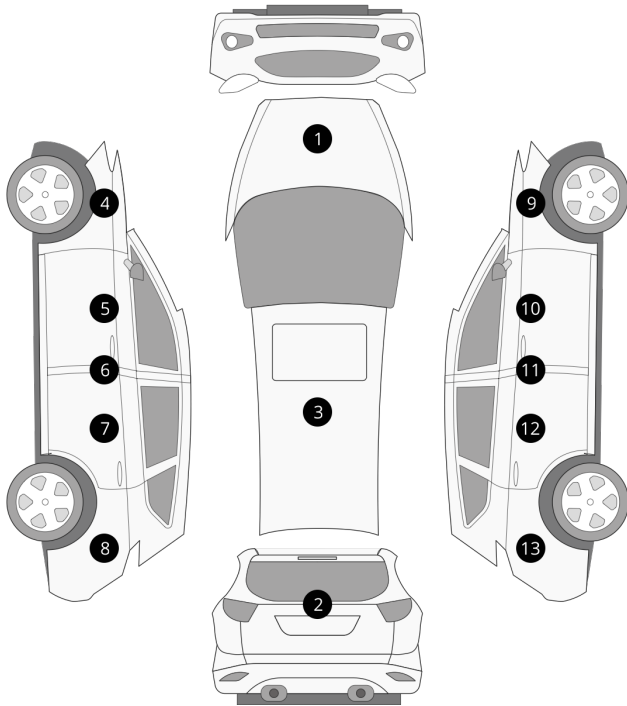


General Information

Date & Time: 20, Feb, 2026 15:55

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	24,874
Registration No.	DAQ5810 - NON-MOVING	Chassis No.	MHKA4DF5FNJ068205
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



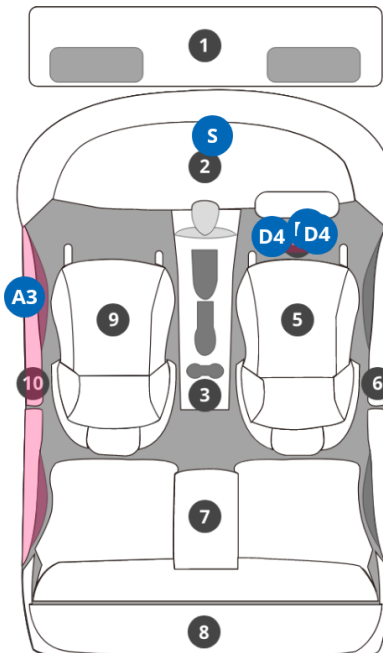
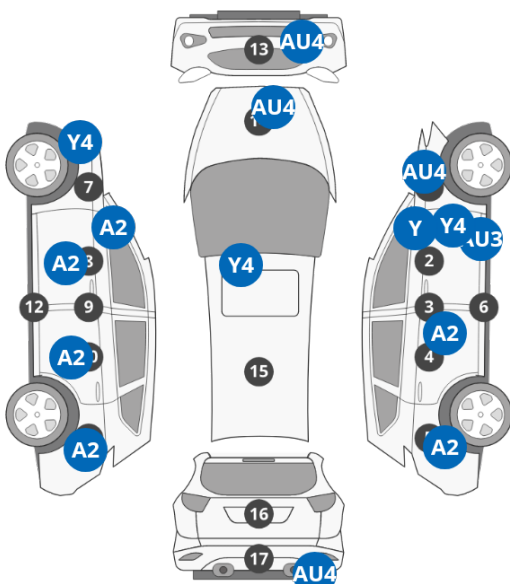
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	79.5	79	79	81
2	Boot Lid	82.4	81	83	84
3	Roof	70.3	62	75	76/69
4	Left Front Fender	69.5	73	72	63
5	Left Front Door	67.9	66	69	69
6	Center Panel Left				
7	Left Rear Door	69.4	69	70	70
8	Left Back Panel	66.3	66	63	71
9	Right Front Fender	82.6	78	84	86
10	Right Front Door	70.2	67	64	79
11	Center Panel Right				
12	Right Rear Door	77.6	82	73	79
13	Right Back Panel	83.8	78	84	90

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is" and this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Large / (L) Front Trim - Cut, Crack - Medium / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / Mat Other - Worked - Large / (R) Front Floor Mat - Worked - Large</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Crack, Gap - Large / (R) Mirror - Crack - Damaged / Front Windshield - Damaged - Large / (L) Front Fender, Molding - Crack, Gap - Large / (L) Mirror - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small</p>
Frame Evaluation : D	Functional Evaluation : E
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

no warranty booklet/ incomplete tools/ non moving vehicle/ with jack and spare tire/ with LTO plate/