

General Information

Date & Time: 19, Nov, 2025 13:02

Make	Toyota	Model	Rush
YOM	2024	Odo Meter Reading	45,990
Registration No.	DBO6782	Chassis No.	MHKE8FF3PRK060258
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



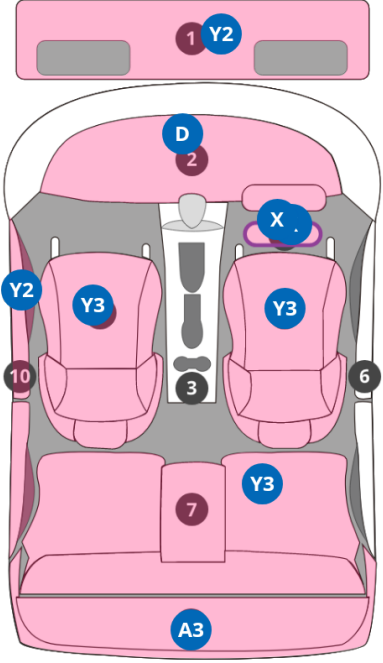
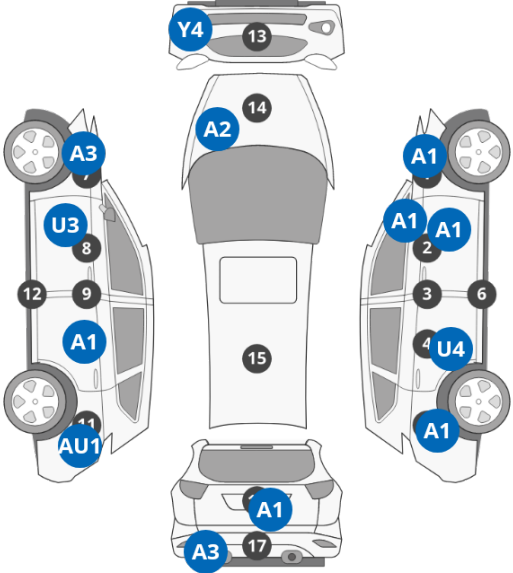
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.7	106	86	99
2	Boot Lid	93.3	95	92	94
3	Roof	96.6	91	88	101/107
4	Left Front Fender	102.3	103	100	104
5	Left Front Door	109.0	106	103	118
6	Center Panel Left				
7	Left Rear Door	110.0	119	102	109
8	Left Back Panel	106.3	106	103	110
9	Right Front Fender	101.8	107	99	100
10	Right Front Door	106.0	110	106	102
11	Center Panel Right				
12	Right Rear Door	102.5	105	96	107
13	Right Back Panel	99.3	97	94	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Mat Other - Missing - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Dent - Medium / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with reverse camera/with spare tire/No spare key/No jack and tools/No warranty booklet/front right side and rear floor mats missing</p>