

General Information

Date & Time: 20, Nov, 2025 08:47

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	37,435
Registration No.	NFH9352	Chassis No.	PA1B18F34N4177774
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



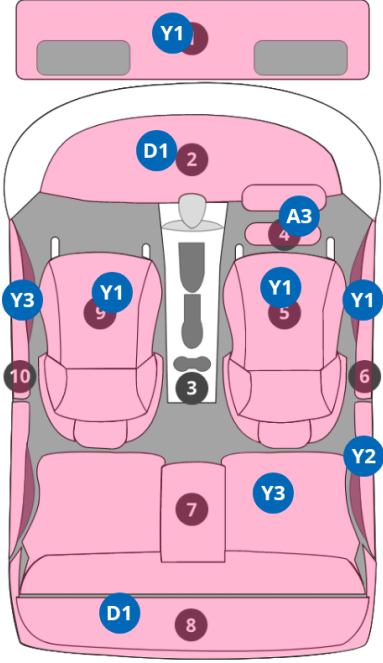
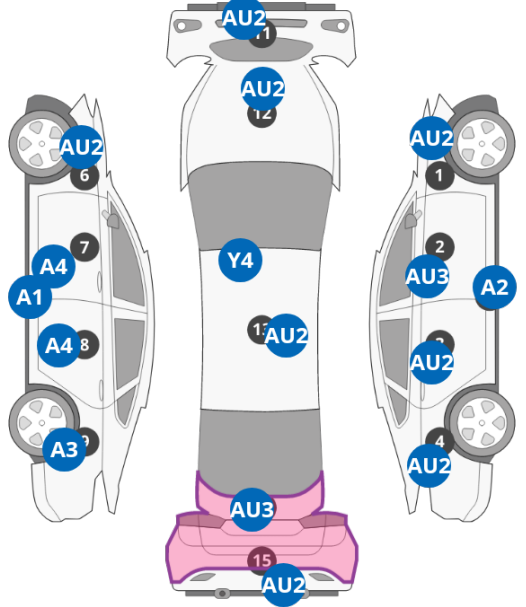
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.5	143	88	98
2	Boot Lid	105.4	107	99	110
3	Roof	96.9	102	100	95/91
4	Left Front Fender	101.3	102	96	106
5	Left Front Door	114.0	107	116	119
6	Center Panel Left				
7	Left Rear Door	108.3	120	103	102
8	Left Back Panel	115.0	125	107	113
9	Right Front Fender	98.5	102	98	96
10	Right Front Door	100.8	100	101	102
11	Center Panel Right				
12	Right Rear Door	104.0	101	101	110
13	Right Back Panel	109.0	109	100	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Minimal / (R) Rear Trim - Grime - Small / Dashboard - Worked - Minimal / Trunk Room - Worked - Minimal / (L) Front Floor Mat - Cut, Crack - Medium</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Front Windshield - Damaged - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with manual & warranty booklet, no reverse camera, no spare tire, with incomplete tools, with spare key, scratches on taillight, issue on windshield.</p>