

General Information

Date & Time: 24, Nov, 2025 15:34

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	43,805
Registration No.	NGQ3573	Chassis No.	PA1B18F32N4178325
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



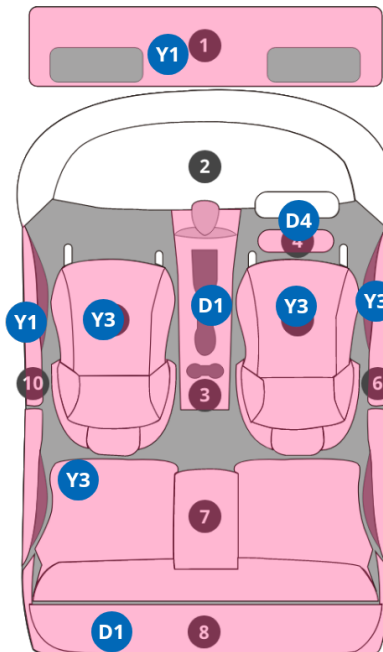
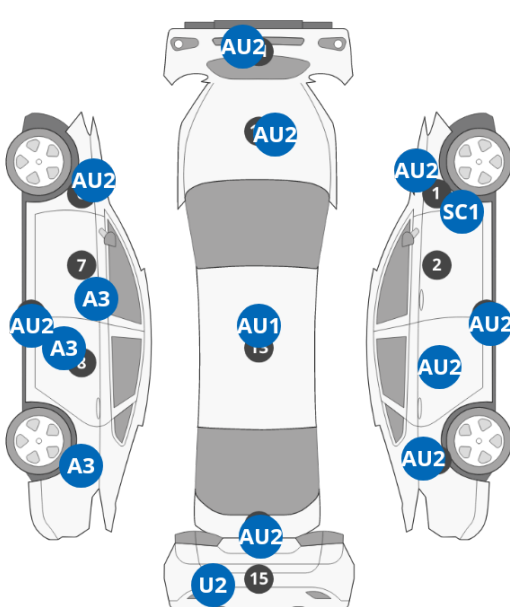
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	126	96	110
2	Boot Lid	109.6	111	108	110
3	Roof	95.0	98	95	94/93
4	Left Front Fender	100.0	98	100	102
5	Left Front Door	106.0	106	108	104
6	Center Panel Left				
7	Left Rear Door	105.6	107	106	104
8	Left Back Panel	115.6	126	116	105
9	Right Front Fender	102.2	101	108	98
10	Right Front Door	100.6	102	100	100
11	Center Panel Right				
12	Right Rear Door	101.3	96	102	106
13	Right Back Panel	108.5	96	102	128

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Large / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / Ceiling - Grime - Minimal / Console, Switches, Vents - Worked - Minimal / (L) Front Trim - Grime - Minimal / Trunk Room - Worked - Minimal</p>	<p>Remarks (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Rust, Corrosion - Minimal / Roof - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with spare key, with incomplete tools & jack, with warranty & manual booklet, no reverse camera, issue on foglamps, issue on brake & plate light, scratches on Taillight.</p>