

General Information

Date & Time: 24, Nov, 2025 09:37

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	29,865
Registration No.	NGQ3574	Chassis No.	PA1B18F37N4178045
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



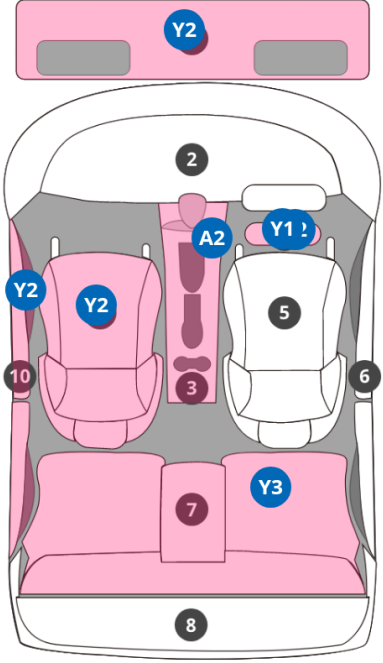
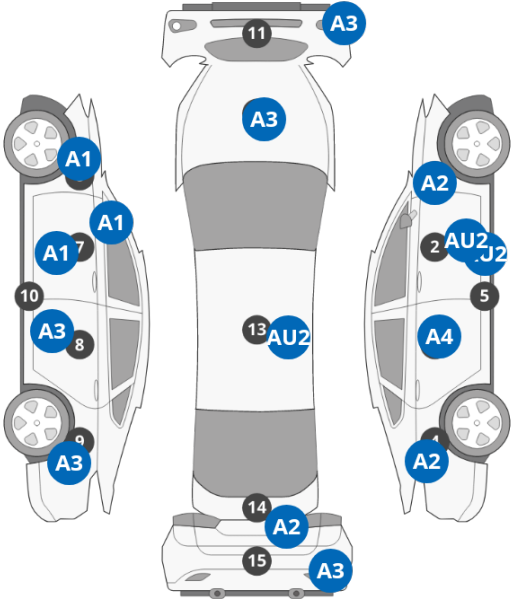
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.7	120	91	115
2	Boot Lid	102.8	102	100	107
3	Roof	95.1	101	97	94/89
4	Left Front Fender	100.0	96	93	111
5	Left Front Door	106.6	110	106	104
6	Center Panel Left				
7	Left Rear Door	105.6	111	105	101
8	Left Back Panel	108.0	120	102	102
9	Right Front Fender	100.3	103	95	103
10	Right Front Door	103.0	100	105	104
11	Center Panel Right				
12	Right Rear Door	102.3	100	98	109
13	Right Back Panel	102.7	99	88	121

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium / (R) Front Floor Mat - Grime - Minimal / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with warranty booklet/No reverse camera/with jack and incomplete tools/with spare key/plate light issue/parking light issue /rear seat issue</p>