

General Information

Date & Time: 18, Nov, 2025 10:35

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	7,262
Registration No.	DBU4873	Chassis No.	MHFAA1BY2S0041523
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Green		

Body / Panel Condition



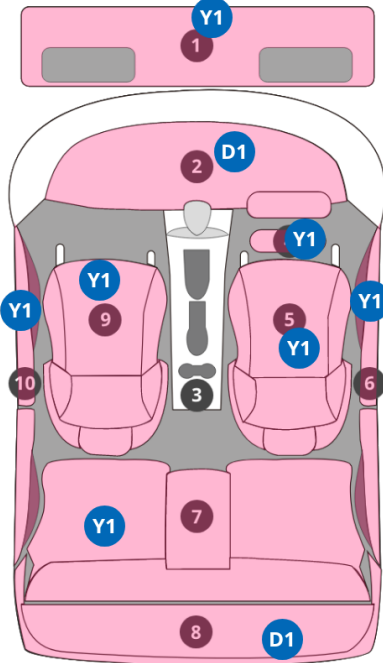
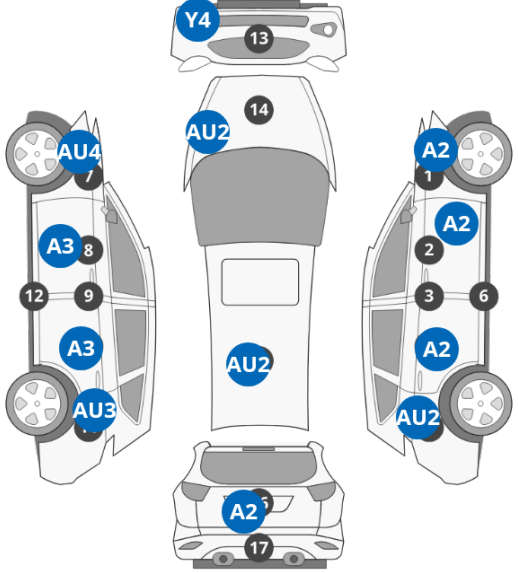
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	136.6	107	137	166
2	Boot Lid	109.3	113	113	102
3	Roof	121.2	135	122	107/121
4	Left Front Fender	115.6	120	114	113
5	Left Front Door	122.6	115	119	134
6	Center Panel Left				
7	Left Rear Door	126.0	139	112	127
8	Left Back Panel	134.3	132	127	144
9	Right Front Fender	107.3	105	115	102
10	Right Front Door	118.3	120	113	122
11	Center Panel Right				
12	Right Rear Door	120.0	120	111	129
13	Right Back Panel	139.3	169	116	133

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / Trunk Room - Worked - Minimal / Dashboard - Worked - Minimal / (L) Front Floor Mat - Grime - Minimal</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Door, Molding - Scratch - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with manual & warranty booklet, with reverse camera, with spare tire, no tools & jack, foglamp issue left side, scratches on taillight.</p>