

General Information

Date & Time: 21, Nov, 2025 09:31

Make	Suzuki	Model	Dzire
YOM	2022	Odo Meter Reading	90,763
Registration No.	LAK5596	Chassis No.	MBHZF6359NG173336
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



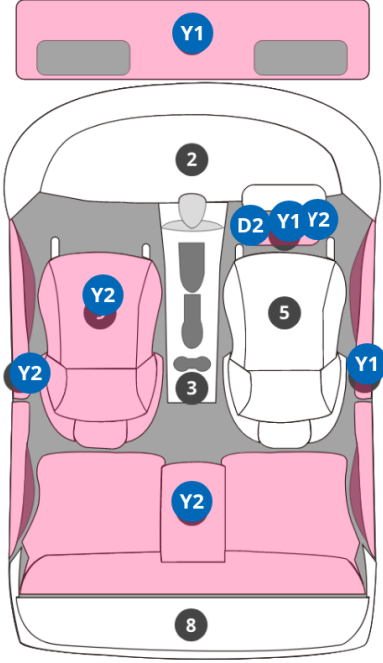
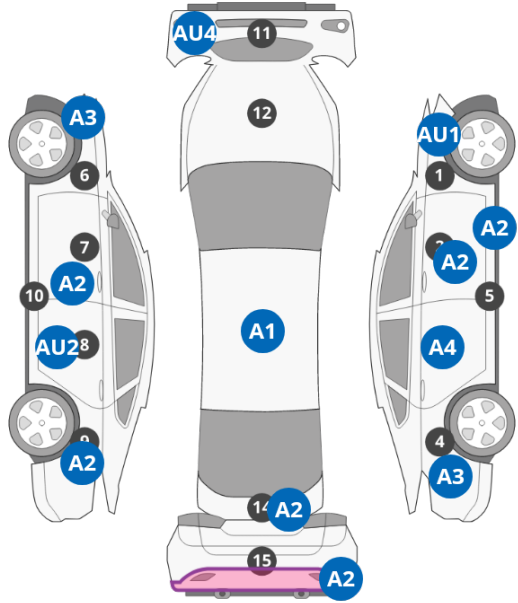
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	134.0	124	152	126
2	Boot Lid	141.6	136	146	143
3	Roof	102.9	99	100	104/109
4	Left Front Fender	138.0	151	141	122
5	Left Front Door	167.3	148	159	195
6	Center Panel Left				
7	Left Rear Door	161.6	175	161	149
8	Left Back Panel	163.0	164	153	172
9	Right Front Fender	103.3	97	102	111
10	Right Front Door	145.0	156	130	149
11	Center Panel Right				
12	Right Rear Door	163.0	176	137	176
13	Right Back Panel	165.3	134	160	202

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Minimal / Mat Other - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet, tools, and seat cover. With spare tire, and jack. 1 key. Temporary plate.</p>