

General Information

Date & Time: 17, Nov, 2025 15:58

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	68,766
Registration No.	BAH3020	Chassis No.	PA2JA8EM0S0153329
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



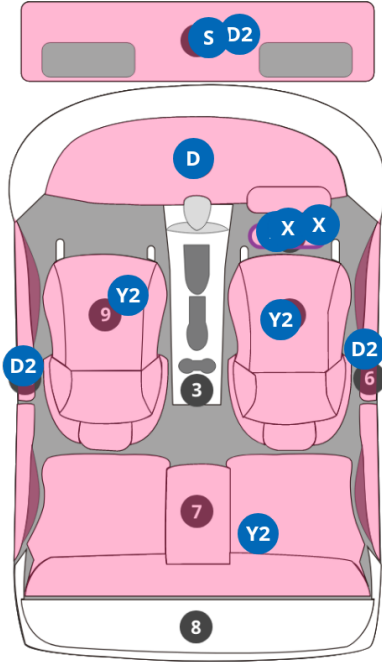
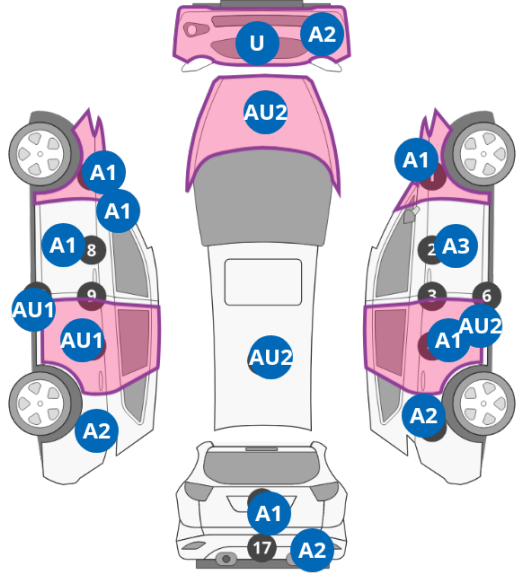
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	113	118	117
2	Boot Lid	101.3	104	99	101
3	Roof	99.6	96	101	95/107
4	Left Front Fender	94.9	107	100	78
5	Left Front Door	101.4	104	103	97
6	Center Panel Left				
7	Left Rear Door	110.6	108	113	111
8	Left Back Panel	99.4	97	106	96
9	Right Front Fender	103.7	105	113	93
10	Right Front Door	95.3	92	97	97
11	Center Panel Right				
12	Right Rear Door	101.3	100	104	100
13	Right Back Panel	108.0	110	109	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Crinkle - Small / Overall Interior - Smell - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light and worn tires, foglight missing, adhesive marks on vehicle, no spare key, plate light issue.