

General Information

Date & Time: 17, Nov, 2025 17:12

Make	Toyota	Model	Innova
YOM	2016	Odo Meter Reading	64,381
Registration No.	DEB1204-1	Chassis No.	TGN1403150005
CC	2.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Blackish Red Mica		

Body / Panel Condition



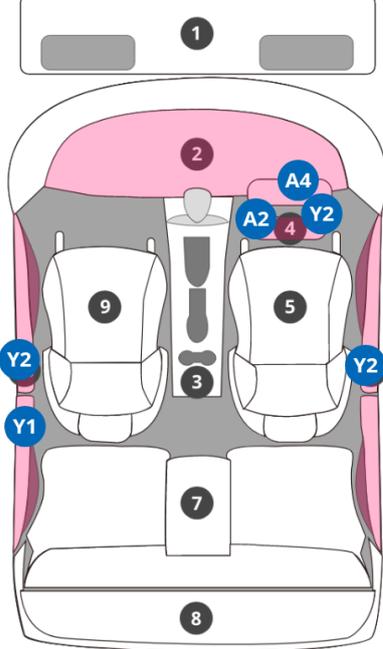
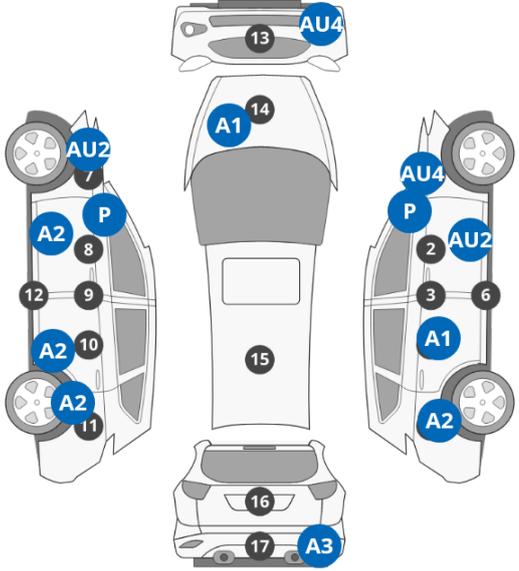
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.6	129	129	134
2	Boot Lid	126.3	122	125	132
3	Roof	128.2	122	130	133/128
4	Left Front Fender	122.6	128	123	117
5	Left Front Door	122.6	132	123	113
6	Center Panel Left				
7	Left Rear Door	120.3	119	118	124
8	Left Back Panel	125.3	123	128	125
9	Right Front Fender	126.0	122	119	137
10	Right Front Door	123.0	120	119	130
11	Center Panel Right				
12	Right Rear Door	120.3	118	121	122
13	Right Back Panel	124.3	110	135	128

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Steering Wheel - Worn, Peel, Crack - Large / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Minimal / (L) Front Floor Mat - Cut, Crack - Small / (R) Front Floor Mat - Grime - Small</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Rear aircon issue. Possible flooding. Wet carpet at the rear. With warranty booklet, spare tire, jack and tools. 1 key. With LTO plate.</p>