

General Information

Date & Time: 17, Nov, 2025 18:57

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	14,753
Registration No.	DBM8964	Chassis No.	PA1B18F34R4242855
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



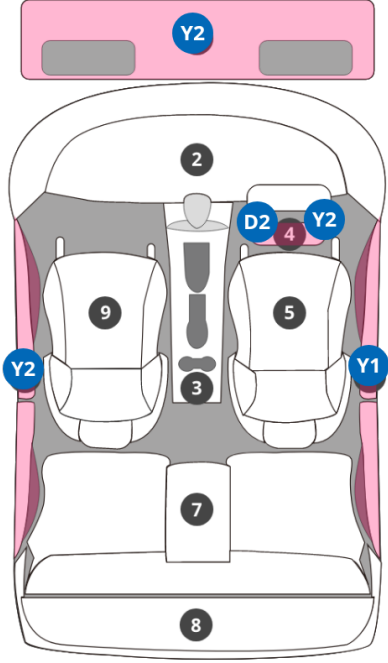
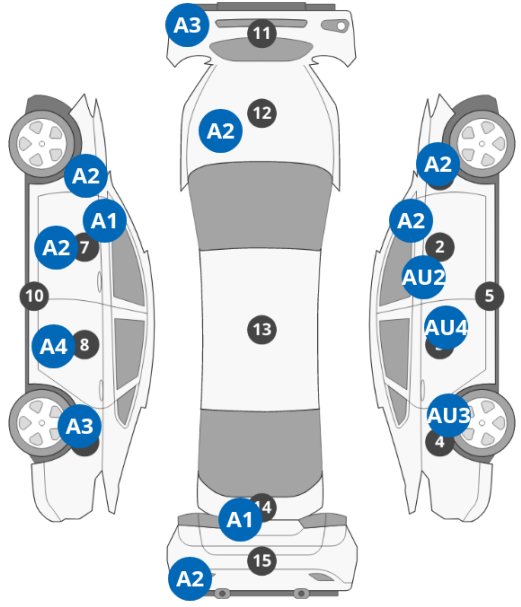
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	113	100	112
2	Boot Lid	100.3	97	97	107
3	Roof	95.8	104	92	96/91
4	Left Front Fender	231.3	240	234	220
5	Left Front Door	176.3	181	181	167
6	Center Panel Left				
7	Left Rear Door	100.6	111	99	92
8	Left Back Panel	101.6	102	100	103
9	Right Front Fender	93.7	97	90	94
10	Right Front Door	97.7	100	97	97
11	Center Panel Right				
12	Right Rear Door	105.4	97	105	114
13	Right Back Panel	101.8	105	101	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Minimal</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Trunk floor missing. Without warranty booklet,jack and tools. With spare tire and seat cover. 1 key. With LTO plate.</p>