

General Information

Date & Time: 20, Nov, 2025 10:50

Make	Nissan	Model	Terra
YOM	2019	Odo Meter Reading	63,774
Registration No.	FAE8160	Chassis No.	MNTJCAD23Z0009230
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



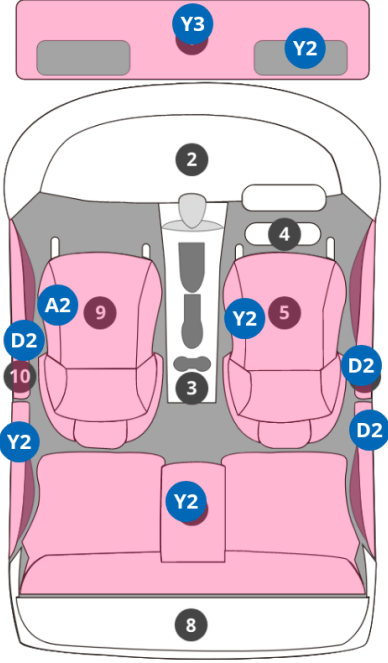
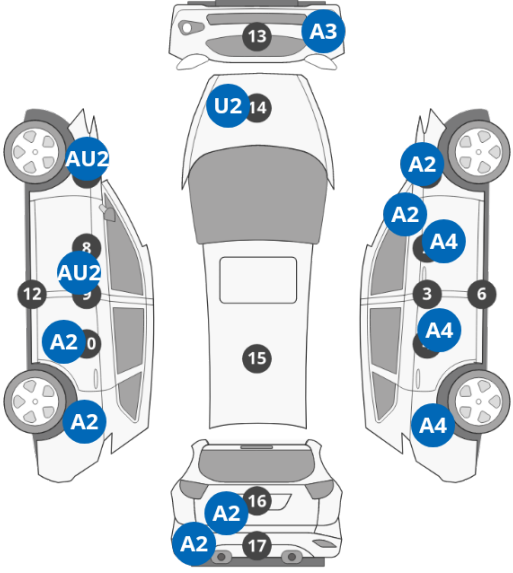
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	208.6	164	174	288
2	Boot Lid	154.6	136	134	194
3	Roof	118.8	79	84	170/143
4	Left Front Fender	167.6	187	167	149
5	Left Front Door	158.0	160	147	167
6	Center Panel Left				
7	Left Rear Door	154.3	160	152	151
8	Left Back Panel	151.6	180	140	135
9	Right Front Fender	406.6	369	414	437
10	Right Front Door	295.3	318	321	247
11	Center Panel Right				
12	Right Rear Door	396.6	393	394	403
13	Right Back Panel	339.6	313	313	393

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Worked - Small / (L) Front Seat - Cut, Crack - Small / Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small / (R) Front Trim - Worked - Small / (R) Front Seat - Grime - Small / (R) Rear Trim - Worked - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet, tools, jack and seat cover. With spare tire. 1 key. With LTO plate.</p>