

General Information

Date & Time: 10, Dec, 2025 20:02

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	52,377
Registration No.	FAI8913	Chassis No.	PA1B18F31M4168044
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



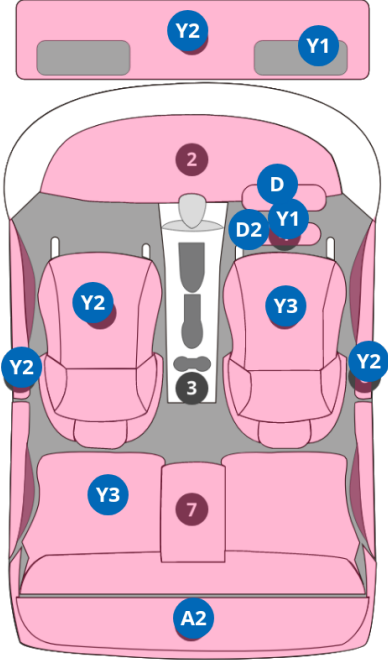
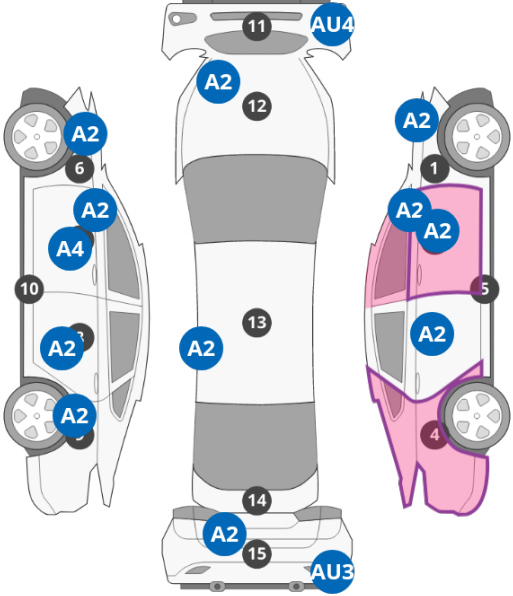
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	115	116	119
2	Boot Lid	109.3	109	111	108
3	Roof	104.3	112	109	101/95
4	Left Front Fender	106.0	121	100	97
5	Left Front Door	109.3	108	105	115
6	Center Panel Left				
7	Left Rear Door	111.3	118	112	104
8	Left Back Panel	114.6	118	116	110
9	Right Front Fender	129.0	133	127	127
10	Right Front Door	166.0	236	135	127
11	Center Panel Right				
12	Right Rear Door	146.0	149	139	150
13	Right Back Panel	146.3	135	130	174

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Grime - Minimal / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Mat Other - Grime - Minimal / Instrument Panel - Traces of Adhesive Tape - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Panel, Meter - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Instrument panel issue. Trunk floor partially missing. Without warranty booklet, jack, tools and seat cover. With spare tire. 1 key. With LTO plate.