

General Information

Date & Time: 17, Dec, 2025 19:42

Make	Toyota	Model	Rush
YOM	2024	Odo Meter Reading	16,104
Registration No.	FAR5411	Chassis No.	MHKE8FF3PRK059760
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Black		

Body / Panel Condition



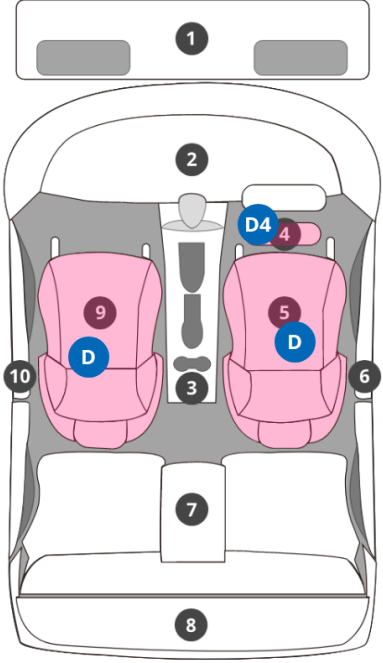
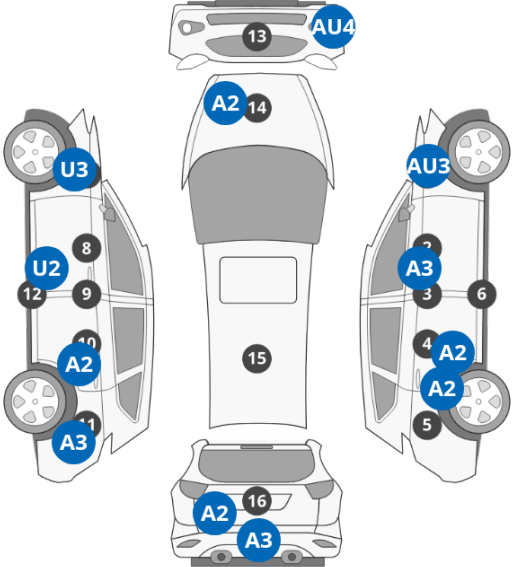
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.3	126	108	127
2	Boot Lid	108.6	105	113	108
3	Roof	118.2	112	116	116/129
4	Left Front Fender	111.6	112	111	112
5	Left Front Door	116.3	118	115	116
6	Center Panel Left				
7	Left Rear Door	114.3	122	113	108
8	Left Back Panel	108.2	117	110	98
9	Right Front Fender	112.6	112	115	111
10	Right Front Door	118.3	120	119	116
11	Center Panel Right				
12	Right Rear Door	116.6	114	116	120
13	Right Back Panel	107.3	101	104	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Floor Mat - Crinkle - Large</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Fender, Molding - Dent - Medium / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>fog light issue/ air-conditioning auto button not working/ no jack and tools/ with spare tire and LTO plate/</p>