

General Information

Date & Time: 16, Dec, 2025 20:20

Make	Suzuki	Model	S-Presso
YOM	2025	Odo Meter Reading	16,807
Registration No.	FAS6502	Chassis No.	MA3FL61S2SA522966
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



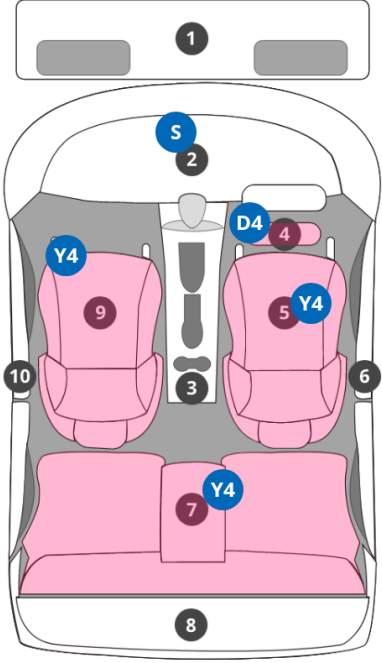
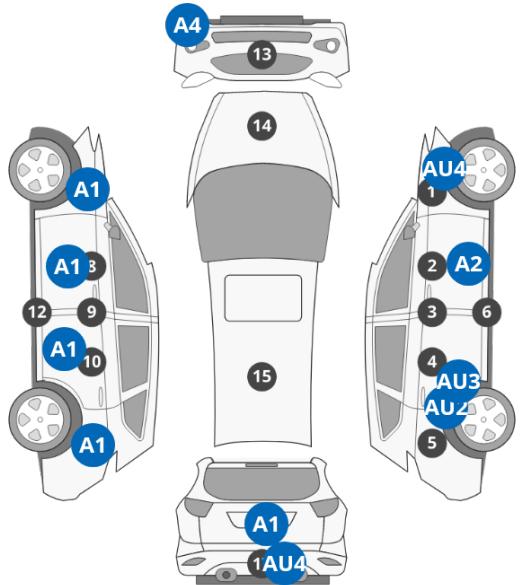
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	119	111	114
2	Boot Lid	101.8	96	108	102
3	Roof	117.5	121	126	113/110
4	Left Front Fender	109.3	106	114	108
5	Left Front Door	123.3	122	126	122
6	Center Panel Left				
7	Left Rear Door	112.3	114	105	118
8	Left Back Panel	125.3	126	124	126
9	Right Front Fender	116.6	115	123	112
10	Right Front Door	113.3	114	108	118
11	Center Panel Right				
12	Right Rear Door	106.6	100	103	117
13	Right Back Panel	116.3	116	112	121

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Large / Overall Interior - Smell - Yes	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no tools and spare tire/ no jack,/ abnormal engine vibration/ no LTO plate/ with warranty booklet/