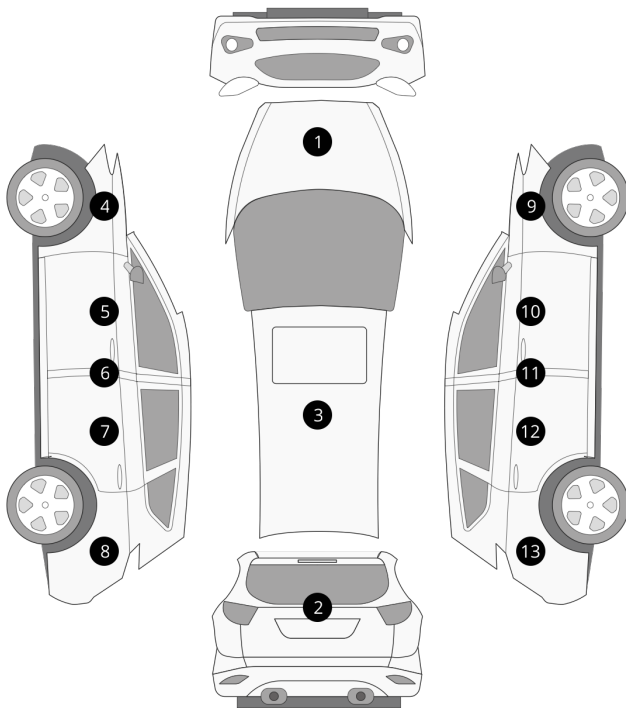


General Information

Date & Time: 29, Nov, 2025 12:58

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	19,692
Registration No.	GBJ1400	Chassis No.	MHFAA1BYXR0035107
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	White		

Body / Panel Condition



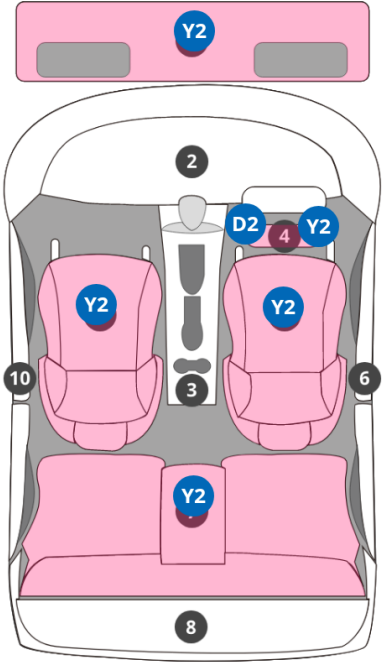
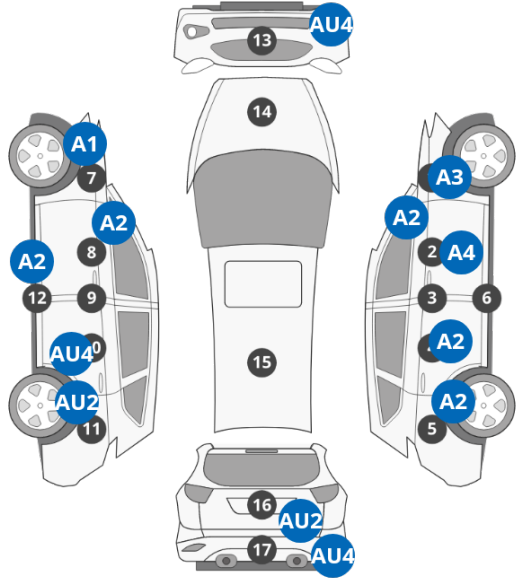
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.5	107	85	116
2	Boot Lid	89.8	94	89	87
3	Roof	103.3	100	103	111/100
4	Left Front Fender	96.3	96	99	95
5	Left Front Door	103.9	97	104	111
6	Center Panel Left				
7	Left Rear Door	104.6	108	103	103
8	Left Back Panel	102.0	103	102	101
9	Right Front Fender	93.0	95	97	87
10	Right Front Door	103.6	107	103	101
11	Center Panel Right				
12	Right Rear Door	101.1	101	98	104
13	Right Back Panel	102.2	100	95	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small	Remarks (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
With warranty booklet, spare tire and jack. Incomplete seat cover. Without tools. 2 keys. Temporary plate. No LTO plate.