

General Information

Date & Time: 12, Dec, 2025 11:09

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	13,370
Registration No.	GBE7412	Chassis No.	PA1B18F35R4257851
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



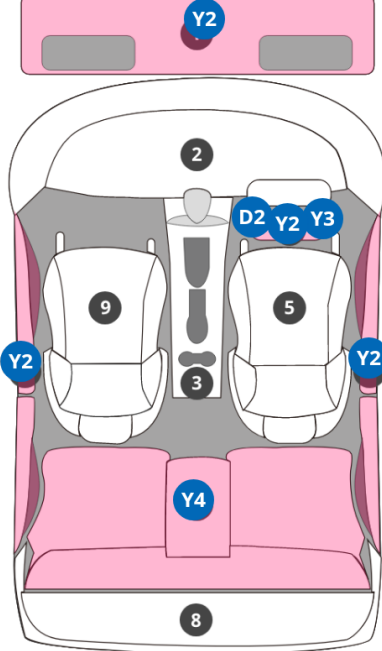
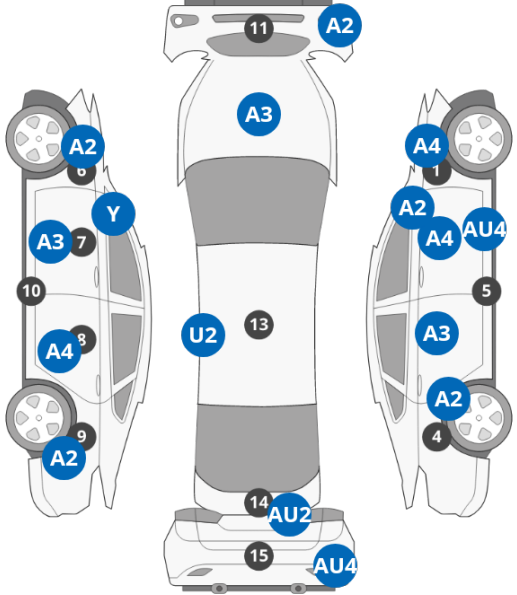
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	104	100	115
2	Boot Lid	107.6	108	101	114
3	Roof	99.5	99	101	95/103
4	Left Front Fender	91.6	93	94	89
5	Left Front Door	156.6	149	160	161
6	Center Panel Left				
7	Left Rear Door	151.3	162	139	153
8	Left Back Panel	149.0	159	154	134
9	Right Front Fender	108.0	106	110	108
10	Right Front Door	106.0	102	102	114
11	Center Panel Right				
12	Right Rear Door	108.0	101	110	113
13	Right Back Panel	104.0	102	108	102

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Large / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Dent - Small / (L) Mirror - Crack - Cracks
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes

Inspector Notes

Rear left door cannot open. Left side mirror crack. unusual sound when opening front right door. Gap at front and rear bumper. Without warranty booklet, spare tire, jack and tools. With seat cover. 3 keys. With LTO plate.