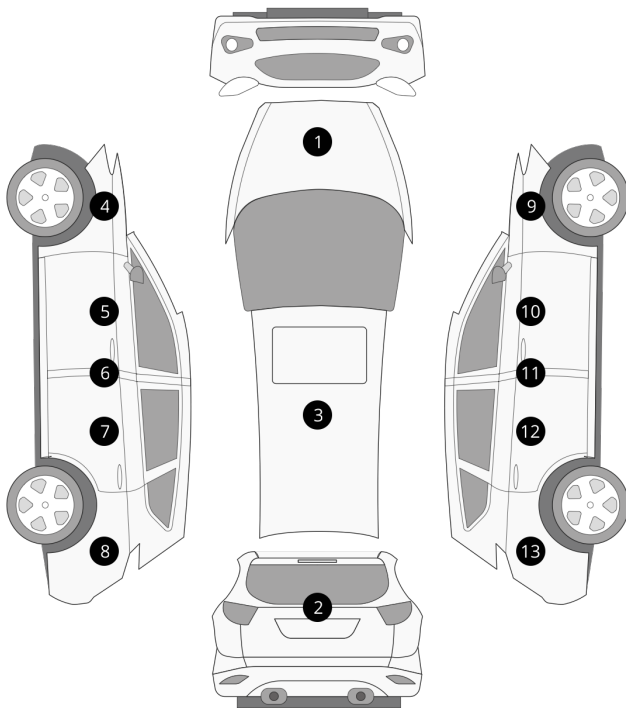


General Information

Date & Time: 29, Nov, 2025 08:49

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	53,468
Registration No.	GAV7298	Chassis No.	MHKA4DF5FMK060669
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



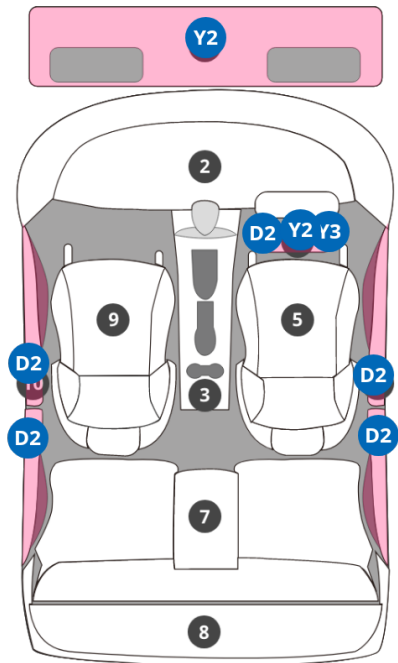
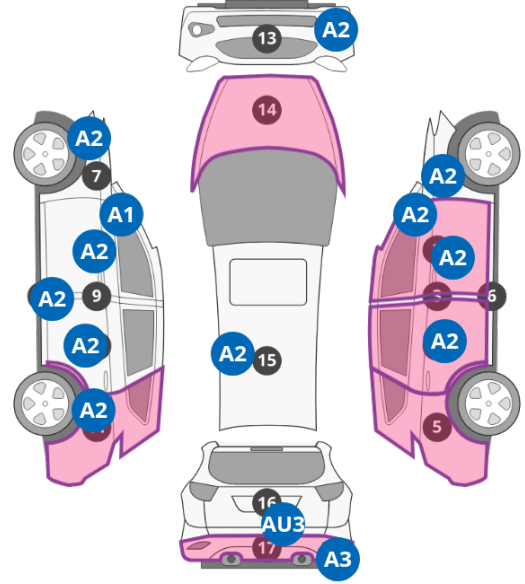
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	317.6	254	318	381
2	Boot Lid	88.3	84	94	87
3	Roof	72.6	64	80	73/74
4	Left Front Fender	153.6	137	142	182
5	Left Front Door	81.6	80	84	81
6	Center Panel Left				
7	Left Rear Door	84.6	86	85	83
8	Left Back Panel	76.1	78	76	74
9	Right Front Fender	228.3	221	257	207
10	Right Front Door	145.0	177	131	127
11	Center Panel Right				
12	Right Rear Door	147.6	139	128	176
13	Right Back Panel	139.0	121	133	163

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Worked - Small / (R) Rear Trim - Worked - Small / (L) Rear Trim - Worked - Small / Mat Other - Grime - Small / (L) Front Trim - Worked - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Remote Key & Smart entry - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Remote key issue. Without warranty booklet and tools. With jack, spare tire, and leather seat cover. 1 key. With LTO plate.