

General Information

Date & Time: 13, Dec, 2025 12:54

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	19,631
Registration No.	GBD7374	Chassis No.	MHKAA1BC8RJ024431
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



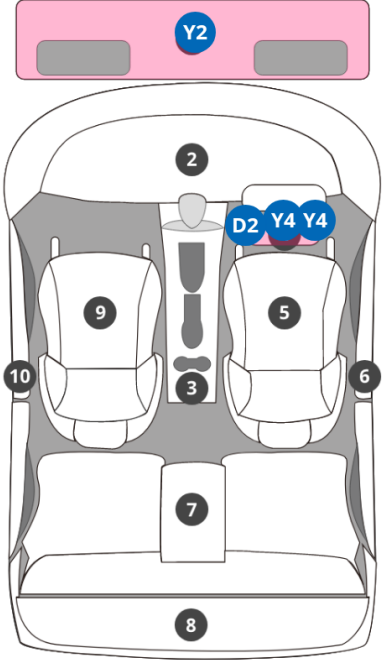
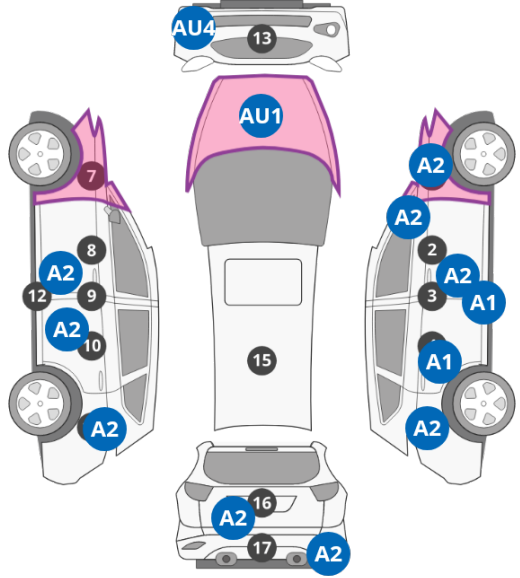
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	252.0	276	254	226
2	Boot Lid	90.7	92	91	90
3	Roof	77.7	80	84	73/74
4	Left Front Fender	120.3	140	109	112
5	Left Front Door	109.6	105	110	114
6	Center Panel Left				
7	Left Rear Door	102.3	113	101	93
8	Left Back Panel	94.6	94	88	102
9	Right Front Fender	139.6	145	142	132
10	Right Front Door	115.3	123	116	107
11	Center Panel Right				
12	Right Rear Door	106.1	95	102	121
13	Right Back Panel	229.9	266	340	84

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Large / Mat Other - Grime - Large / (L) Front Floor Mat - Worked - Small	Remarks Bonnet - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Carpet and mattings has molds. Without warranty booklet and tools. With spare tire, jack and seat cover. 1 key. No LTO plate.