

## General Information

Date & Time: 28, Nov, 2025 13:11

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	6,017
<b>Registration No.</b>	HAH5567	<b>Chassis No.</b>	MHKAA1BC4RJ828041
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Red		

## Body / Panel Condition



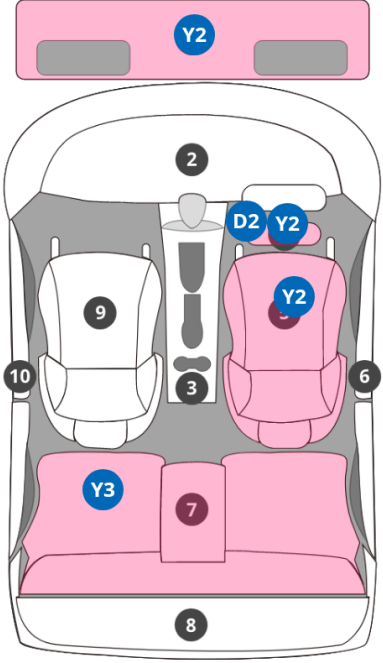
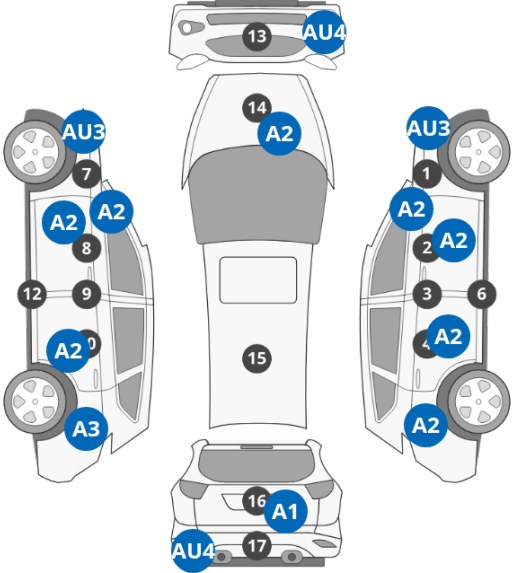
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.2	109	105	96
2	Boot Lid	82.3	74	88	85
3	Roof	83.5	80	92	85/78
4	Left Front Fender	90.2	86	84	101
5	Left Front Door	104.6	102	100	112
6	Center Panel Left				
7	Left Rear Door	94.8	99	95	90
8	Left Back Panel	93.2	99	90	91
9	Right Front Fender	88.4	92	90	83
10	Right Front Door	109.6	111	114	104
11	Center Panel Right				
12	Right Rear Door	102.9	92	104	113
13	Right Back Panel	95.0	96	93	96

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / Mat Other - Grime - Small / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small</p>	<p><b>Remarks</b> Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet, jack, toolx and seat cover. With spare tire. 1 key. With LTO plate.</p>