

General Information

Date & Time: 08, Jan, 2025 12:31

Make	Toyota	Model	Vios
YOM	2023	Mileage	20,310
Registration No.	DBG7914	Chassis No.	PA1B18F35P4202944
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



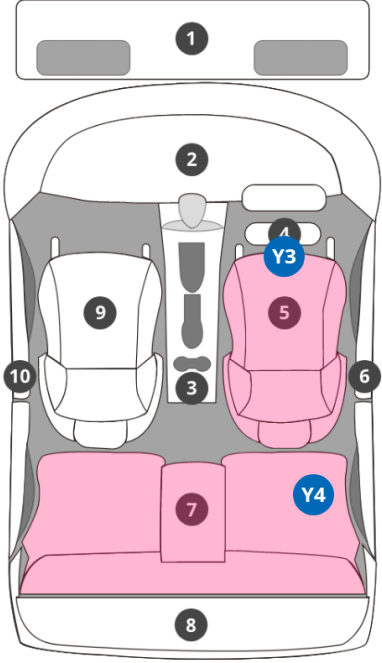
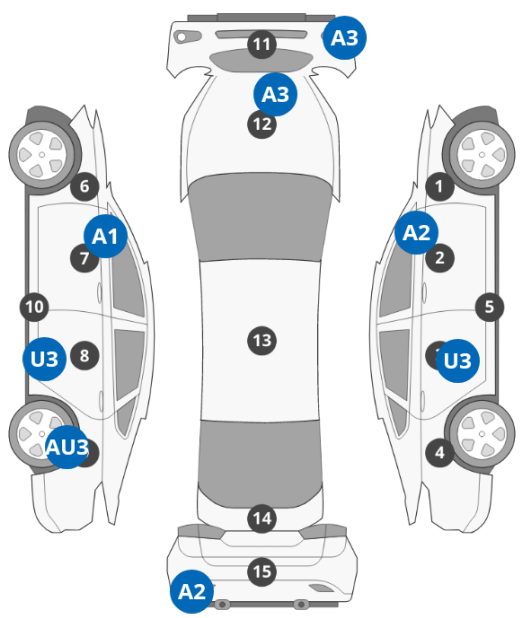
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.1	93	94	107
2	Boot Lid	103.0	97	110	102
3	Roof	94.1	97	89	95/96
4	Left Front Fender	92.3	97	91	89
5	Left Front Door	93.0	95	92	92
6	Center Panel Left				
7	Left Rear Door	100.8	102	106	95
8	Left Back Panel	101.7	93	107	105
9	Right Front Fender	93.5	100	88	93
10	Right Front Door	93.8	91	93	98
11	Center Panel Right				
12	Right Rear Door	97.5	91	93	108
13	Right Back Panel	96.7	94	92	104

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (R) Rear Door, Molding - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Dent - Medium / Bonnet, Headlight - Scratch - Medium / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with spare tire, tools, and jack/ without warranty booklet/ without reverse camera feature