

General Information

Date & Time: 21, Nov, 2025 16:13

Make	Toyota	Model	Innova
YOM	2022	Odo Meter Reading	83,830
Registration No.	NFK9555	Chassis No.	PA2JA8EM7N0105301
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Blackish Red Mica		

Body / Panel Condition



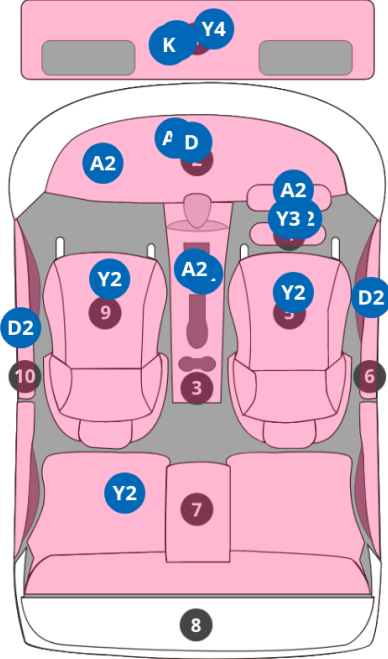
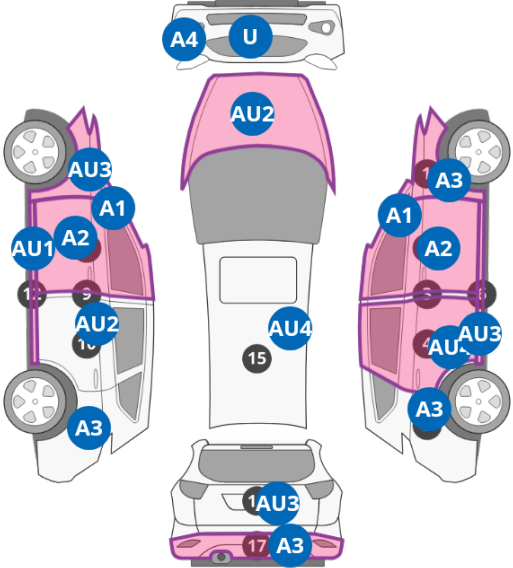
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.8	87	106	95
2	Boot Lid	106.3	100	112	107
3	Roof	92.0	88	82	104/94
4	Left Front Fender	101.5	98	100	107
5	Left Front Door	104.9	106	109	100
6	Center Panel Left				
7	Left Rear Door	104.3	104	103	106
8	Left Back Panel	107.3	111	109	102
9	Right Front Fender	88.7	86	90	91
10	Right Front Door	96.1	90	103	96
11	Center Panel Right				
12	Right Rear Door	98.2	95	100	99
13	Right Back Panel	102.2	106	92	109

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / Mat Other - Grime - Medium / Ceiling - Grime - Large / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Knobs - Worn, Peel, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch and crack tail light and headlight, foul smell, possible flooded, warning lamps on, Aircon issue, headlight and tail light issue, Room light and plate light busted, foglight issue, worn tires and Sparetire.