

General Information

Date & Time: 20, Nov, 2025 15:59

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	26,429
Registration No.	BAG3957	Chassis No.	PA1B18F30R4258941
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



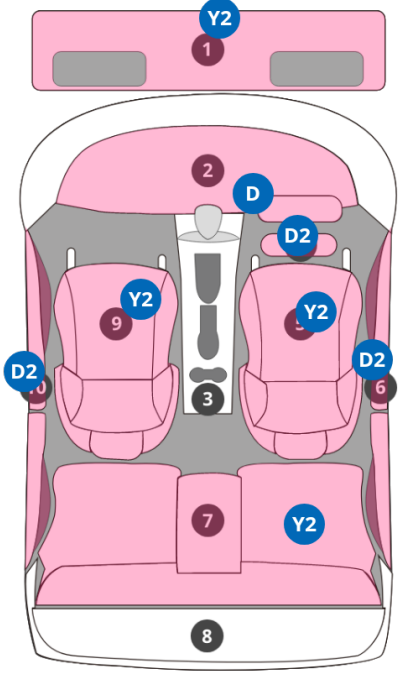
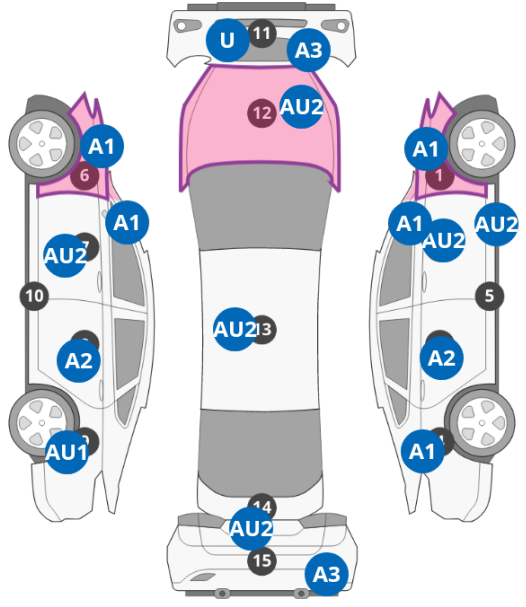
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	117	108	113
2	Boot Lid	104.0	101	105	106
3	Roof	101.7	108	96	111/92
4	Left Front Fender	94.5	91	96	96
5	Left Front Door	108.0	111	106	107
6	Center Panel Left				
7	Left Rear Door	109.6	116	108	105
8	Left Back Panel	109.6	113	108	108
9	Right Front Fender	96.2	98	96	95
10	Right Front Door	98.9	100	98	99
11	Center Panel Right				
12	Right Rear Door	101.8	104	98	104
13	Right Back Panel	108.3	103	106	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small</p>
Frame Evaluation : C	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire, Incomplete Tools, with warranty booklet, No Jack, No Spare key, Scratch and Crack Tail light and Headlight, worn tires, tow hook cover missing, paint splash on car, plate light issue, Room light issue.</p>