

General Information

Date & Time: 24, Nov, 2025 15:00

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	13,464
Registration No.	CCP2908	Chassis No.	MHKAA1BC4SJ038302
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



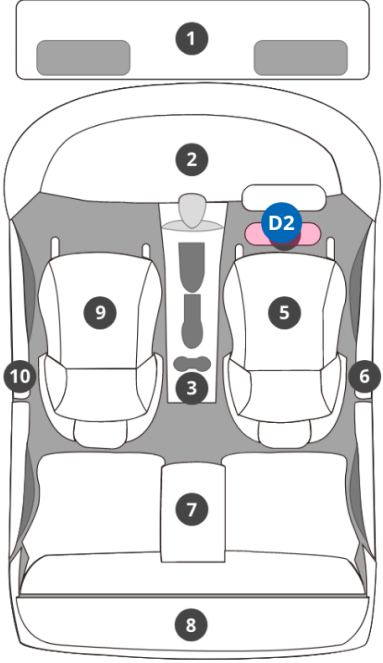
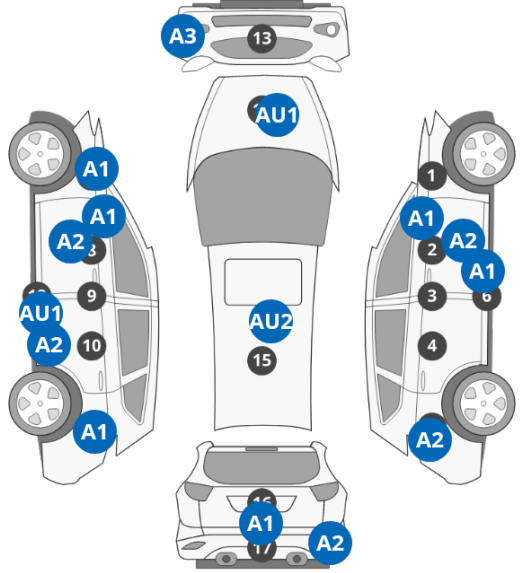
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	113	110	122
2	Boot Lid	103.7	99	113	99
3	Roof	97.2	98	90	99/101
4	Left Front Fender	99.3	102	99	97
5	Left Front Door	105.3	108	103	105
6	Center Panel Left				
7	Left Rear Door	102.5	112	94	102
8	Left Back Panel	97.8	99	98	97
9	Right Front Fender	92.1	89	93	95
10	Right Front Door	103.3	106	100	104
11	Center Panel Right				
12	Right Rear Door	105.3	108	100	108
13	Right Back Panel	94.4	91	96	96

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, worn tires, foul smell, Scratch headlight and tail light.</p>