

## General Information

Date & Time: 21, Nov, 2025 16:09

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	11,265
<b>Registration No.</b>	NKD2343	<b>Chassis No.</b>	PA1B18F34R4255511
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



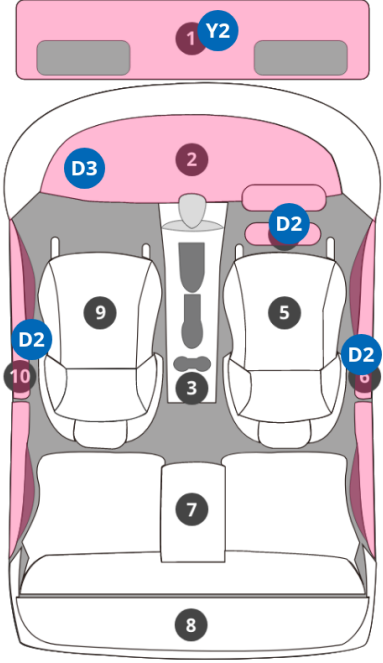
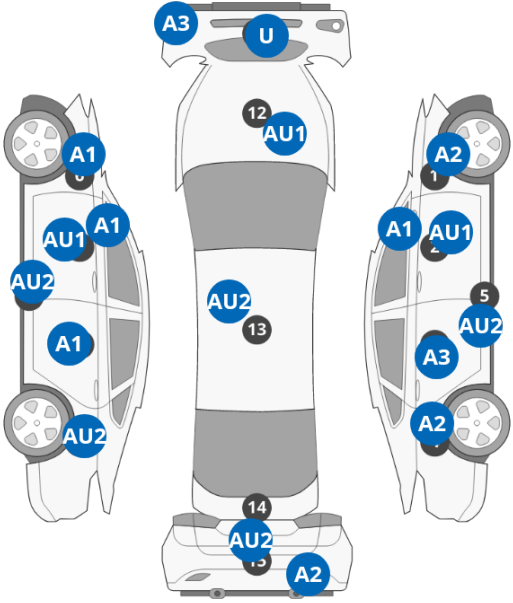
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	111	111	119
2	Boot Lid	119.3	117	123	118
3	Roof	94.0	98	87	96/95
4	Left Front Fender	98.9	103	98	96
5	Left Front Door	105.0	101	111	103
6	Center Panel Left				
7	Left Rear Door	104.0	105	106	101
8	Left Back Panel	114.6	114	114	116
9	Right Front Fender	101.3	103	99	102
10	Right Front Door	109.6	103	119	107
11	Center Panel Right				
12	Right Rear Door	108.3	103	114	108
13	Right Back Panel	112.6	111	110	117

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Loose, Deformed - Medium</p>	<p><b>Remarks</b> Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch &amp; Dent - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>E</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

With LTO plate, No warranty booklet and Sparetire and Jack and Tools, scratch headlight and tail light, no spare key, no air-conditioned, foul smell, worn tires, adhesive marks on vehicle, Abnormal vibration on engine,missing parts under the on dashboard in driver side.